

Ranger[®] 7000 Scales Instruction Manual





1.	INTRODUCTION	4
••	1.1 Description	
	1.2 Features	
	1.3 Definition of Signal Warnings and Symbols	
	1.4 Safety Precautions	
2	INSTALLATION	
۷.		
	2.1 Unpacking 2.2 Installing Components	
	2.2.1 Terminal Setup	
	2.2.2 Installing the Wind Ring, Weighing Platform	
	2.3 Selecting the Location2.4 Connecting Power and Turning ON the Scale	0
	2.4 Connecting Power and Furning ON the Scale	
	2.6 Leveling the scale	
	2.7 Remote Terminal Operation	
	2.7 Remote Ferminal Operation2.8 Separating the Terminal from the Weighing Base	
	2.9 Terminal Mounting	
	2.10 Initial Calibration	
	2.10.1 Internal calibration	
	2.10.2 External calibration	
3	OPERATION	
5.	3.1 Overview of Display, Home Screen	
	3.2 Principal Functions and Main Menu	
	3.3 Overview of Parts and Features	
٨	APPLICATIONS	
4.	4.1 Weighing	
	4.1 Application Setup	
	4.1.2 Accumulation	
	4.1.3 Input/Output (I/O) Setup	
	4.1.5 input/output (#O) Setup	
	4.2.1 Set the Average Piece Weight (APW)	
	4.2.2 Application Setup	
	4.2.3 Smart Sampling	
	4.2.4 Accumulation	
	4.2.5 Input/Output (I/O) Setup	
	4.3 Check	
	4.3.1 Check Weighing (default)	
	4.3.2 Check Counting	
	4.3.3 Application Setup	
	4.3.4 Input/Output (I/O) Setup	
	4.4 Formulation	
	4.4.1 Free Formulation (default)	
	4.4.2 Recipe Formulation	. 24
	4.4.3 Factor and Tolerance Setup	. 25
	4.4.4 Application Setup	. 26
	4.4.5 Input/Output (I/O) Setup	. 26
	4.5 Percent Weighing	
	4.5.1 Establishing a Reference Weight	
	4.5.2 Application Setup	
	4.6 Filling	
	4.6.1 Target Weight and Set Points Setup	
	4.6.2 Application Setup	
	4.6.3 Input/Output (I/O) Setup	
	4.7 Dynamic Weighing	
	4.7.1 Application Setup	
	4.7.2 Average Time Setup	
	4.7.3 Input/Output (I/O) Setup	
	4.8 Density Determination	
	4.8.1 Application Setup	
	4.8.2 Water Temperature / Liquid Density Setup	
	4.9 Differential Weighing	. 36

	4.9.1 Application Setup	. 37
	4.9.2 Differential Operation	
	4.10 Sieve Weighing	
	4.10.1 Application Setup	. 38
	4.10.2 Sieve Operation	
	4.11 Library	
	4.11.1 Creating a Library Record	
	4.11.2 Retrieving a Library Record	
	4.11.3 Editing a Stored Library Record	. 42
	4.11.4 Deleting a Stored Library Record	. 42
	4.12 Additional Features	. 43
	4.12.1 Weigh Below	. 43
5.	MENU SETTINGS	.43
	5.1 Menu Navigation	
	5.2 Main Menu	
	5.3 Calibration	
	5.3.1 Calibration sub-menu	
	5.3.2 Zero Calibration	
	5.3.3 Span Calibration	
	5.3.4 Linearity Calibration	
	5.3.5 Internal Calibration (R71MHD models)	
	5.3.6 Automatic Calibration (R71MHD models)	
	5.3.7 AutoCal™ Adj (Adjustment)	
	5.3.8 GEO Adjustment.	
	5.4 Setup	
	5.4.1 Scale Setup sub-menu	
	5.4.2 Reset	
	5.4.3 Language	
	5.4.4 Power On Unit	
	5.4.5 Power On Zero	
	5.4.6 Key Beep	
	5.4.7 Expand Display	
	5.4.8 Barcode Rule	
	5.5 5.5 Read Out	
	5.5.1 Reset	
	5.5.2 Stability	
	5.5.3 Zero Range	
	5.5.4 Filter level	
	5.5.5 Auto Zero Tracking	
	5.5.6 Brightness	
	5.5.7 Auto Dim (minutes)	
	5.5.8 Auto Sleep (minutes)	
	5.6 Application Mode	
	5.6.1 Turning an Application ON/OFF	50
	5.7 Weighing Units	
	5.7.1 Units Sub-menu.	
	5.7.2 Reset	
	5.7.3 Turning a Unit ON/OFF	
	5.8 GLP and GMP Data	
	5.8.1 Reset	
	5.8.2 Date Format	
	5.8.3 Date	
	5.8.4 Time Format	
	5.8.5 Time	
	5.8.6 Project ID	
	5.8.7 Scale ID	
	5.9 Communication	
	5.9.1 Reset	
	5.9.2 Baud Rate	
	5.9.3 Parity	
	5.9.4 Stop Bits	
	5.9.5 Handshake	
	5.9.6 Alternate Command	
	0.0.0 Alternate Command	. 52

	9.7 Reference Balance	
	9.8 Reset	
5.9	9.9 Stable Weight Only	53
	9.10 SICS	
	9.11 Print Options	
5.9	9.12 Auto Print	53
5.9	9.13 Select Template	
5.9	9.14 Edit Template	
	9.15 Edit String	
	9.16 Data Transfer	
	10 User Profiles	
5.1	11 Memory	60
5.1	11.1 USB memory	60
	11.2 Alibi memory	
	12 Maintenance	
	12.1 Export Library	
	12.2 Export User Profile	
	12.3 Import' Library Drives	
	12.4 Import User Profile	
6. SE	ERIAL COMMUNICATION	64
6.1	1 Interface Commands	64
6.2	2 RS232 Interface	65
6.2	2.1 Connecting to a Computer	65
6.2	2.2 Connecting to a Serial Printer	
6.3	3.1 System Requirements	
	3.2 USB Connection	
6.3	3.3 Virtual Port Software Installation	
6.4		
6.5		
6.6		
7. LE	EGAL FOR TRADE	68
7.1	1 Settings	
7.2	2 Verification	
7.3	3 Sealing	
8. M	AINTENANCE	69
8.1	1 Calibration	
8.2	2 Information	
8.3	3 Cleaning	
8.4	4 Troubleshooting	71
8.5	5 Service Information	71
8.6	6 Software Updates	71
9. TE	ECHNICAL DATA	72
9.1	1 Specifications	
9.2		
9.3	0	
9.4		
9.5		
10.CC	OMPLIANCE	

1. INTRODUCTION

1.1 Description

The Ranger 7000 scale is a precision weighing instrument that will provide you with years of service if properly cared for. The Ohaus Ranger 7000 scales are available in capacities from 3000 grams to 60 kilograms.

1.2 Features

Modular Design: Ohaus Ranger 7000 scales are composed of two interconnected modules: a Terminal and a Base. Depending on the user's needs, the unit can be operated with the Terminal either attached to, or remote from, the Base, with a single interconnect cord 2 meter long. An optional tower kit and extended cord are also available as accessories.

1.3 Definition of Signal Warnings and Symbols

Safety notes are marked with signal words and warning symbols. These show safety issues and warnings. Ignoring the safety notes may lead to personal injury, damage to the instrument, malfunctions and false results.

Signal Words

WARNING	for a hazardous situation with medium risk, possibly resulting in injuries or death if not avoided.
CAUTION	for a hazardous situation with low risk, resulting in damage to the device or the property or in loss of data, or injuries if not avoided.
Attention Note	For important information about the product For useful information about the product

Warning Symbols



1.4 Safety Precautions



Caution: Read all safety warnings before installing, making connections, or servicing this equipment. Failure to comply with these warnings could result in personal injury and/or property damage. Retain all instructions for future reference.

- Verify that the input voltage range printed on the data label and the plug type matches the local AC power to be used.
- Only connect models supplied with a grounded power cord to a compatible grounded power receptacle.
- Do not position the scale such that it is difficult to disconnect the power cord from the power receptacle.
- Make sure that the power cord does not pose a potential obstacle or tripping hazard.
- This scale is for indoor use only.
- Use the scale in dry locations only.
- Do not drop loads on the pan.
- Use only approved accessories and peripherals.
- Operate the equipment only under ambient conditions specified in these instructions.
- Disconnect the equipment from the power supply when cleaning.
- Do not operate the equipment in hazardous or unstable environments.
- Service should only be performed by authorized personnel.

2. INSTALLATION

2.1 Unpacking

Carefully remove your Ranger 7000 scale and each of its components from the package. The included components vary depending on the scale model (see table below). Save the packaging to ensure safe storage and transport.

Included	d Component	Photo	R71MHD3 R71MHD6	R71MD3 R71MD6	R71MHD15 R71MHD35	R71MD15 R71MD35 R71MD60
Terminal			х	x	Х	х
In-Use Cover			x	x	х	х
Weighing Base			х	х	х	х
Weighing Platform	210 x 210 mm		х			
Weighing Platform	280 x 280 mm			x		
Weighing Platform	311 x 371 mm				х	х
Wind Shield			x			
Compact Disc	Instruction Manual		х	х	Х	х

2.2 Installing Components

Refer to the illustrations and instructions below to identify and assemble your Ranger 7000 scale with its components. All components must be assembled before using the scale.

2.2.1 Terminal Setup

When the Ranger 7000 is delivered, the Terminal is already attached (docked) to the Base. No additional setup is necessary. Refer to the illustrations and instructions below to identify and assemble your Ranger 7000 Scale. **Note:** The Terminal is identical for all Ranger 7000 Scale models.

 
2.2.2 Installing the Wind Ring, Weighing Platform

- 1. Place the Wind Ring in position (R71MHD3, R71MHD6).
- 2. Place the platform onto the spider.



2.3 Selecting the Location

Avoid excessive vibrations, heat sources, air current, or rapid temperature changes. Allow sufficient space.



Note: Interface cables connect to the terminal. The terminal can be detached and mounted on a wall or positioned on a table separate from the scale.

2.4 Connecting Power and Turning ON the Scale

The Ranger 7000 comes with an AC power cord. Connect the power cord to a suitable grounded electrical outlet and press the ON button on the side of the base (see figure below).



Power ON button on the side of the base



Attention: Allow equipment to warm up for 60 minutes for optimal weighing performance.

2.5 Connecting the Interface

The Ranger 7000 scale has 4 interfaces on the back of the terminal:

- RS422: used to communicate with the base
- RS232: used to connect to computer or a printer
- USB host
- USB slave



 
Interface connections on back of Terminal.



Thread terminal cable along cable coils on bottom of scale. Or pass cable through groove near release button.

2.6 Leveling the scale

Only scales that have been leveled precisely horizontally provide accurate weighing results. The certified scales have a spirit level to simplify alignment.



Turn the adjustable feet of the scale until the spirit level's air bubble is inside the inner circle.

2.7 Remote Terminal Operation

The Terminal communicates with the weighing base via the Terminal cable. This cable must be plugged into the Terminal for the Ranger 7000 to display properly. If desired, the Ranger 7000 scale may be operated either with the Terminal attached, or remotely (up to 1.5 meters away).

2.8 Separating the Terminal from the Weighing Base

- 1. To detach, press both the Release buttons inward (both at the same time) and gently pull the Terminal towards you (outward) until the Terminal is detached. These Release buttons disengage the two hooks holding the Terminal to the Base. A cable is attached to the Terminal. Take care to not damage or disconnect this cable.
- 2. To reattach the Terminal, press in the two Release buttons and slide the Terminal into the Base until the Terminal hooks click and engage to hold the Terminal in place.




Release Buttons



2.9 Terminal Mounting

If desired, the Terminal may be mounted to a wall or table using fasteners (not supplied) that are appropriate for the type of mounting surface.

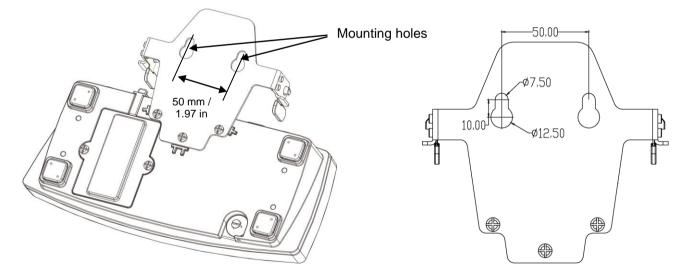

2.10 Initial Calibration

When the Scale is first installed, and when it is moved to another location, it must be calibrated to ensure accurate weighing results.

2.10.1 Internal calibration

R71MHD models have built in AutoCal which can calibrate the scale automatically and does not require calibration masses. If preferred, the scale can be manually calibrated with external masses. Have the appropriate calibration masses available before beginning calibration. Refer to the Calibration Section for masses and calibration procedure.

2.10.2 External calibration

R71MD models can only be manually calibrated with external masses.

OPERATION 3.

3.1 Overview of Display, Home Screen CONTROLS

	Weighing Max 6000 g d= 0.1 g 1200 AM 01/01/1970 Φ × Δ<	1 2 3 1 ▲▲ 2 ABC DEF
	G U.U g	4 5 6 GHI JKL MNO 7 8 9
OHAUS'	Tare Wt.: 0.0 g * Σ Ι Ι Ι Ι	7 8 9 PORS TUV WXYZ gkg . 0 CLR 0 User +/-
	RANGER 7000	→0← →T←

Button	Action			
	Enter/Exit the library menu			
	Switch between available application modes			
	Send the meas settings.	surement data to available communications ports according to current		
(i)	Display informa	ation about Application Mode, Library, User and Menu		
	Enter/Exit the l	Jser menu		
g kg Ib	g kg b Switch the main weighing unit between the available units			
	2 ABC WXYZ	Short Press: Input '2'-'9' To Enter 'A' press 2 times. For lower case 'Z', press 5 times.		
$ \begin{array}{c c} 1 \\ 1 \\ \hline \hline $	0 User	Short Press: Input '0' Long Press: Go to User Login screen		
7 8 9 PQRS TUV WXYZ . 0 CLR	1 1 🗚 2	Short Press: Input '1' Long Press: Switch platform between scale 1 and scale 2		
User +/-	CLR +/-	Short Press: Clear character/string when editing string If no input is active, clear the current active library When there is no value added, pressing this button will switch the value sign between positive and negative.		
		Short Press: Input '-', space, '_' To Enter '_' press . 3 times.		
→0 ←	Perform Zero operation			
→T←	Perform Tare operation When entering the value first and then pressing this button the number input will be set to preset Tare value.			



3.2 Principal Functions and Main Menu

MENU &	MENU & SCREEN NAVIGATION				
Press the	Press the Menu witton to open the menu list.				
	button below and and to move				
To select	the highlighted menu item, press	ss v	to move back to previous screen.		
	Calibration: Select to view calibration options.	Mair	n Menu		
- And	Setup: Select to view user preferences.	🔔 Calibra			
	Read Out: Select to view scale settings.	Read C	Dut >		
	Application Modes: Select to view application modes.	Weighing Unit Image: GLP / GMP Data			
9 kg	Weighing Units: Select to view weighing units.				
	GLP and GMP Data: Insert user data for traceability.		Memory: Select to view USB Memory and Alibi memory settings.		
And the second s	Communication: Select to view communication settings.	Ÿ	Maintenance: Select to view Maintenance settings.		
	User Profile: Select to view User Profile settings.				

3.3 Overview of Parts and Features




APPLICATIONS 4.

The scale can be configured to operate in various Application modes, see section 5.6 for information on how to

activate/deactivate each application mode. Press to select an activated application. The current application will be shown in the upper left corner of the home screen (See section 3.1).

The Ranger 7000 incorporates the following Applications

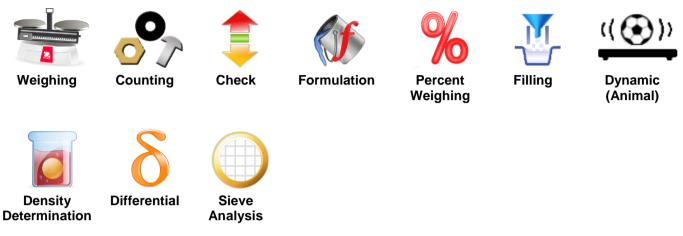

Note: Before using any application, be sure the scale has been leveled and calibrated.

4.1 Weighing

Use this application to determine the weight of items in the selected unit of measure.

Press the button until Weighing is displayed in the upper left portion of the home screen (this application is the default).

Press Tare or Zero if necessary to begin.

Place objects on the pan to display the weight. When stable, the * appears.

The resulting value is displayed in the main Weighing Line in the active unit of measure.



The WEIGHING Home screen

Main Display Line

Reference Fields



Application Icon

Note: Refer section 9.5, or press the

Functions

(i) button for button icon explanation.

4.1.1 **Application Setup**

The Application can be customized for various user preferences.

Press the button corresponding to the icon to enter Configuration.

The **Configuration** screen is now displayed.

Select the list item and press the button

corresponding to **example**, to change the setting as desired.

To return to the Application home screen, press the

button corresponding to

** Configuration			
Auto Tare	Off		
Chain Tare	On		
Accumulate	Manual		
Statistics	Off		

The Weighing Configurations are defined below (defaults in Bold)

Item	Available Settings	Comments
Auto Tare	On, Off	To enable Automatic Tare
Chain Tare	On , Off	To enable Chain (Continuous) Tare
Accumulate	Off, Automatic, Manual	To enable Accumulation / Totalization
Statistics	On , Off	To enable Statistics

4.1.2 Accumulation

To start Accumulate weighing data, place the item on the pan and press the button corresponding to the icon

The top accumulation icon will start blinking. The load to be accumulated has to be >= 5d and the next accumulation can only start once the pan has been cleared.

Note: The Accumulation icon will only be shown if Accumulate is set to Manual (see section 4.1.1).

Viewing the Statistics results

When Statistics is set to ON, press the info button (i) to view the statistics results.

Viewing the Accumulation results

To view the accumulation results, press the info button



then press the button corresponding to the icon

The Accumulate Result screen is displayed.

Note: To return to home screen press the _____ button.

Press the button to print Accumulation result.



Accumulate Result
Number of Samples : 0
Total : 0.0 g
Average : 0.0 g
Minimum : 0.0 g
Maximum : 0.0 g
Range : 0.0 g
[Press CLR to clear the accumulate data.]
[Press Print Key to print the accumulate data.]

Clearing the Statistics / Accumulation results

To clear the statistic / accumulation results, press the button

A warning message appears. Press the button corresponding

to the icon to confirm the deletion or press the button

corresponding to the icon to abort the deletion and return to previous screen.

Note: The accumulate/statistic information will be cleared automatically when selecting a new library

4.1.3 Input/Output (I/O) Setup

The I/O's can be customized for various user preferences.

The I/O's are defined below (defaults in **Bold**).

Item	Available Settings
Discrete Input 1	Off, Zero, Tare, Clear Tare, Print, Unit, Accumulate
Discrete Input 2	Off, Zero, Tare, Clear Tare, Print, Unit, Accumulate
Discrete Output 1	Off, Overload, Underload
Discrete Output 2	Off, Overload, Underload
Discrete Output 3	Off, Overload, Underload
Discrete Output 4	Off, Overload, Underload

Note: The I/O's will only work when the I/O Option Board have been installed. See the Accessory list in section 9.4 for information.

The option I/O board provides two isolated inputs and four dry-contact normally open relay outputs which can be used for simple process weighing.

Press the button to enter the Main Menu.

With the button corresponding to the **sector** icon, go down the list and highlight **Application Mode**. Enter this sub-menu

by pressing the button corresponding to the **example** icon.

Main Menu	
🚨 Calibration	>
🔀 Setup	≻
重 Read Out	≻
Figure Application Mode	≻
% Weighing Unit	≻
🔙 GLP / GMP Data	≻

In the Application Mode menu enter the **Weighing** sub-menu.

Application Mode	
🍓 Reset	≻
📷 Weighing	>
🔗 Counting	≻
章 Check	≻
🀠 Formulation	≻
% Percent	≫



EN-15

The Weighing sub-menu is now displayed.

Select the list item and press the button corresponding to

the 📃

icon to change the setting as desired.

Weighing		
🃀 Enable	On	>
🚧 Discrete Input 1	Off	>
ko Discrete Input 2	Off	≻
🥡 Discrete Output 1	Off	≻
iscrete Output 2	Off	≻
🮲 Discrete Output 3	Off	≻
	÷	\checkmark

4.2 Counting

Use this application to count samples of uniform weight.

Counting

Press the button until **Counting** is displayed in the upper left portion of the home screen. The default (or last) Average Piece Weight (APW) is displayed.

Setup APW value according to section 4.2.1 and then place objects on the pan to display the number of pieces.

🔗 Counting	Max 6000 g d= 0.1 g 00:00 01/01/1970	- - Σ
* G	54	7 ²
Weight: Tare Wt.:	54.7 g APW: 0.0 g	0.1000 g
📽 PCS	APW 10	Σ

The COUNTING Home screen

Main Display Line



Reference Fields Functions

PCS

Note: Refer section 9.5, or press the _____ button for button icon explanation.

4.2.1 Set the Average Piece Weight (APW)

Note: It is recommended that the APW is larger than 1d. If APW is between 0.05d and 1d, a warning screen will be displayed and the information line will show 'Low APW'. If APW is less than 0.05d an error screen will appear and the APW value cannot be stored.

There are three ways to set the APW:

1. Positive Sampling

Place the sample on the pan and then key in the number of pieces using the alphanumerical keypad and press the button

corresponding to the PCS icon to confirm.

Alternatively, press the button corresponding to the icon. A numeric input screen appears.

Key in the desired number of pieces using the alphanumerical keypad, and then press the button corresponding to the icon

The display returns to the Home screen.

Enter PCS			
Samples			PC
		X	

Place 10 pieces of sample on the pan and press the button

corresponding to the icon to perform sampling with default reference size.

Note:

The reference size can be changed in the Counting configuration.

2. Negative Sampling

Place container with the samples on the pan and Tare the scale, a NET 0 will be displayed. Remove the samples from the container; a negative net reading will be displayed. Input the sample size with the numeric keypad and then press the button

corresponding to the icon <u>PCS</u>. The value will be displayed on the screen.

Alternatively, press the button corresponding to the PCS icon.

A numeric input screen appears.


Key in the desired number of pieces using the alphanumerical keypad, and then press the button

corresponding to the **Live** icon.

The display returns to the Home screen.

Sampling can also be performed by pressing the

button corresponding to the icon with preset reference size.

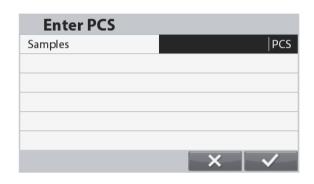

Enter APW	
APW	g
	X - V

3. Entering a Known APW

Key in the Piece Weight using the alphanumerical keypad and

press the button corresponding to the APW icon to confirm and store the APW.

Alternatively, press the button corresponding to the APW icon.

A numeric input screen appears.

Key in the Piece Weight using the alphanumerical keypad, then

press the button corresponding to the **example** icon. The display returns to the Home screen with the new APW value displayed in the reference field.

Notes:

When current unit is metric (g, kg), APW unit is g. When current weighing unit is imperial (lb, oz), APW unit is lb.

6.0000 g

4.2.2 Application Setup

The Application can be customized for various user preferences.

Press the button corresponding to the even icon to enter Configuration .	Counting * G Weight: Tare Wt.: P
The Configuration screen is now displayed.	🐨 Configu
Select the list item and press the button	Auto Tare
corresponding to the second second icon to change the	Chain Tare
setting as desired.	Accumulate

To return to the Application home screen, press

the button corresponding to

Configuration	า	
Auto Tare	Off	
Chain Tare	On	
Accumulate	Manual	
Auto Opt.	On	
APW Auto Save	On	
Opt. Beep	On	

900.0g

cs

0.0 g

APW

APW:

The Counting Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Auto Tare	On, Off	Turns Automatic Tare on/off
Chain Tare	On , Off	To enable/disable Chain (Continuous)Tare
Accumulate	Off, Automatic, Manual	To enable/disable Accumulation / Totalization
Auto Opt.*	On , Off	To enable/disable Automatic Optimization of APW
APW Auto Save*	On , Off	To enable/disable APW Automatic save
Opt. Beep	On , Off	To enable/disable Optimization Beep
Internal Resolution	On , Off	To enable/disable internal counting resolution
Smart Sampling	On, Off	To enable/disable Smart Sampling
Reference Size	1 10 999	Set reference size

Note: * If APW value is directly entered (not through sampling) or calculated from the reference balance (displayed as APW(B)), this feature does not work.

4.2.3 Smart Sampling

When connected to reference balance or 2nd platform, smart sampling allow user to perform sampling without manually switching platforms.

When smart sampling is turned On

Sampling will always be performed from the reference balance (if reference balance is ON). If reference balance is OFF, sampling will <u>be performed</u> from the main platform.

Press the button corresponding to the icon to perform sampling with the weight on the reference balance (or main platform if reference balance is OFF). The counting results will be displayed on the current platform.

When smart sampling is turned Off:

Sampling will be performed on the current platform.

Note: Refer to section 5.9.7 on how to connect to reference balance.

4.2.4 Accumulation

See section 4.1.2 for details about the Accumulation feature.

4.2.5 Input/Output (I/O) Setup

The I/O's can be customized for various user preferences. The I/O's are defined below (defaults in **Bold).**

Item	Available Settings
Discrete Input 1	Off, Zero, Tare, Clear Tare, Print, Unit, Accumulate
Discrete Input 2	Off, Zero, Tare, Clear Tare, Print, Unit, Accumulate
Discrete Output 1	Off, Overload, Underload
Discrete Output 2	Off, Overload, Underload
Discrete Output 3	Off, Overload, Underload
Discrete Output 4	Off, Overload, Underload

Note: The I/O's will only work when the I/O Option Board have been installed. See the Accessory list in section 9.4 for information.

The option I/O board provides two isolated inputs and four dry-contact normally open relay outputs which can be used for simple process weighing.

Press the

button to enter the Main Menu.

With the button corresponding to the **button** icon, go down the list and highlight Application Mode. Enter this sub-menu by

pressing the button corresponding to the **example** icon.

Main Menu	
🚨 Calibration	>
🔀 Setup	>
💼 Read Out	≫
Figure Application Mode	>
将 Weighing Unit	>
🔙 GLP / GMP Data	>

In the Application Mode menu enter the **Counting** sub-menu.

Application Mode	
🍊 Reset	>
轖 Weighing	>
🕝 Counting	>
🏮 Check	≻
🀠 Formulation	≻
% Percent	≻

The Counting sub-menu is now displayed.

Select the list item and press the button corresponding to the

icon to change the setting as desired.

Counting		
📀 Enable	On	>
🚧 Discrete Input 1	Off	>
🍫 Discrete Input 2	Off	>
🥡 Discrete Output 1	Off	>
🧀 Discrete Output 2	Off	>
🮲 Discrete Output 3	Off	>
	÷	

4.3 Check

Check is used to compare the weight or pieces of a sample against target limits.


Press the button until **Check** is displayed in the upper left portion of the home screen. Two different modes can be selected: Weight and Pieces.

Three different methods to enter the check limits: Over and Under, Nominal Weight Tolerance, or Nominal Percent Tolerance.

Setup check limits according to section 4.3.1 or 4.3.2. Place object on the pan to check if the weight is within the limits.


4.3.1 Check Weighing (default)

Make sure that the check mode is set to check weighing in the configuration menu **Place** objects on the pan. The **Under/Accept/Over** status is shown in the progress bar area while the actual weight of the item is shown on the main Display Line.

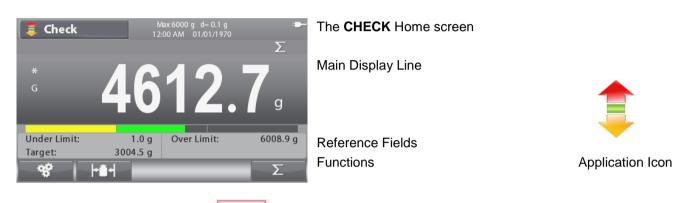

Note: Refer section 9.5, or press the interval button for button icon explanation.

 Defining Over/Under Limits and Tolerance



Select Over or Under Limit and press the button corresponding to the corresponding to the corresponding to the corresponding to the correspondence of the value.

Edit Limit	
Over Limit	5100.0 g
Under Limit	4800.0 g

Enter the desired value for the limit using the alphanumerical keypad. Then press the button corresponding to the **corresponding** to the

Alternatively, the limits can be set by Target Weight Tolerance.

To set the tolerance, press the button corresponding to the icon to enter the **Tolerance setup**.

Edit Limit	
Target	4950.0 g
+ Tolerance	150.0 g
- Tolerance	150.0 g
	G - 🗸 -

To switch between **Over/Under Load**, **Target Weight Tolerance, Target Weight Percentage** press the button corresponding to the field icon. If desired, edit the value by using the alphanumerical keypad and press the button corresponding to the field icon to save the changes and return to the previous screen.

Note: The three set limits methods share the same data.

Edit Limit	
Target	4950.0 g
+ Tolerance	3 %
- Tolerance	3 %

4.3.2 Check Counting

Press the configuration button and select Check Mode to Check Counting. Place objects on the pan. The **Under/Accept/Over** status is shown in the progress bar area while the actual number of pieces is shown on the main Display Line.



Note: Refer section 9.5, or press the interview button for button icon explanation.

Set the Average Piece Weight (APW)

Note: It is recommended that the APW is larger than 1d. If APW is between 0.05d and 1d, a warning screen will be displayed and the information line will show 'Low APW'. If APW is less than 0.05d an error screen will appear and the APW value cannot be stored.

There are three ways to set the APW, see section 4.2.2 for instructions.

Defining Over/Under Limits

Press the button corresponding to the **held** icon to enter


Limit Setup.

Note: See section 4.3.1 for information on how to set the Over/Under limits.


4.3.3 Application Setup

The Application can be customized for various user preferences.

Press the button corresponding to the second icon to enter **Configuration Setup**.

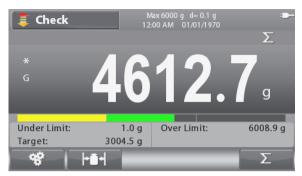

 The **Configuration Menu** is now displayed.



to

, to change the setting as desired.

To return to the Application home screen, press the

button corresponding to

😚 Configuration	
Check Mode	Check Weighing
Audible Signal	Off
Auto Opt.	Off
APW Auto Save	Off
Opt. Beep	Off
Auto Tare	Off

The Check Configurations are defined below (defaults in **Bold**).

Item	Available Settings	Comments
Check Mode	Check Weighing, Check Counting	To set Mode
Audible Signal	Off, Under, Accept, Over, Under& Over	To enable Beeper Signal
Auto Opt*	On, Off	To enable Automatic Optimization of APW
APW Auto Save*	On, Off	To enable APW Automatic save
Opt. Beep*	On, Off	To enable Optimization Beep
Auto Tare	On, Off, On Accept	To enable Automatic Tare 'On Accept' means that if the object weight is within accept range, auto Tare will be performed
Chain Tare	On, Off	To enable Chain (Continuous) Tare
Accumulate	Off, Automatic, Manual , On Accept	To enable Accumulation / Totalization 'On Accept' means that if the object weight is within accept range, auto Accumulate will be performed.
Graph Display	Bar, Block	To set Graph Display Type

Note: * Only available in Check Counting mode.

Positive Check

Positive check is used to determine when the material added to the scale is within the target range. In this case the UNDER and OVER limits must be positive values. (The OVER limit must be greater than or equal to the UNDER limit.)

Negative Check

Negative check is used to determine when the material removed from the scale is within the target range. In this case the UNDER and OVER limits are both negative values.

The UNDER limit must be greater than or equal to the OVER limit (for example: UNDER= -10/OVER= -15). Place the item to be weighed on the scale and press **Tare**.

Remove a portion of the item until it is within the ACCEPT range.

EN-22

Zero Check

Zero check is used when comparing subsequent samples to an initial reference sample. In this case, the UNDER limit must be a negative value and the OVER limit must be a positive value.

Place the reference item on the scale and press **Tare**. Remove the reference sample and place the item to be compared on the scale to determine if it is within the ACCEPT range.


4.3.4 Input/Output (I/O) Setup

The I/O's can be customized for various user preferences.

The I/O's are defined below (defaults in Bold).

Item	Available Settings
Discrete Input 1	Off, Zero, Tare, Clear Tare, Print, Unit, Accumulate
Discrete Input 2	Off, Zero, Tare, Clear Tare, Print, Unit, Accumulate
Discrete Output 1	Off, Under, Over, Accept, Under/Over
Discrete Output 2	Off, Under, Over, Accept, Under/Over
Discrete Output 3	Off, Under, Over, Accept, Under/Over
Discrete Output 4	Off, Under, Over, Accept, Under/Over

 Note: The I/O's will only work when the I/O Option Board have been installed. See the Accessory list in section 9.4 for information. The option I/O board provides two isolated inputs and four dry-contact normally open relay outputs which can be used for simple process weighing.



With the button corresponding to the		icon, go	down
the list and highlight Application Mo	de. Enter	this sub-r	menu
by pressing the button corresponding	to the	✓ ic	on.

Main Menu	
🚨 Calibration	≫
🔀 Setup	≫
💼 Read Out	≫
Figure Application Mode	>
8 Weighing Unit	≻
🔙 GLP / GMP Data	>

In the Application Mode menu enter the **Check** sub-menu.

Application Mode	
🍓 Reset	≻
轖 Weighing	≻
🔗 Counting	≽
🏮 Check	≻
🀠 Formulation	≽
% Percent	≻

The Check sub-menu is now displayed.

Select the list item and press the button corresponding to the

icon to change the setting as desired.

Check		
📀 Enable	On	>
🚧 Discrete Input 1	Off	>
🍫 Discrete Input 2	Off	>
🥡 Discrete Output 1	Off	>
🧀 Discrete Output 2	Off	>
🮲 Discrete Output 3	Off	>

4.4 Formulation

Use this application for compounding and recipe making. The number of components can be 1 to 100. Formulation has two available modes of operation: **Free Formulation** and **Recipe Formulation**.

Press the **Description** button until **Formulation** is displayed in the upper left portion of the home screen.

4.4.1 Free Formulation (default)

This mode of Formulation allows the user to freely add components. A recipe can also be saved and printed when the formulation is finished.



The FORMULATION Home screen

Main Display Line



Reference Fields Functions

Application Icon

Note: Refer section 9.5, or press the interview button for button icon explanation.

Press the button corresponding to the **example** icon to enter the Enter Component screen.

Select the list item and press the button corresponding to the icon _____, to change the value as desired using

the alphanumerical keypad. The item Name and

The item Name and target Weight are required to be entered.

Press the button corresponding to the icon to confirm all the values and continue with the formulation.

Note: The **icon** icon will only appear when all the required values have been entered (name and target weight).

The entered target weight will be used as preset tare.

Place the required weight on the pan (add weight until the displayed value reaches zero again).

When weight matches the tolerance range of the target weight, the display digits will be highlighted. When the displayed value reaches zero, the scale beeps once.

Enter comp.	
PN	11
Name	comp.1
Weight	50 g
Tare	0.0 g



EN-24

RANGER[®] 7000 SCALES

Press the button corresponding to the icon \longrightarrow to confirm the weight for the current component and to continue adding other components.

🚯 Formulatio		/lax 6000 g d= 0.1 1:00 AM 01/01/1		-
Place 50.0g com	p.1.Press Nex	t Comp. to co		
* G >0<	z	50	.0	g
Factor	1.00			
		DN		11
Tolerance	1.00 %	PN:		- 11
*		▶		×

Notes: To terminate the formulation process, press the button corresponding to the **x** icon. If the added weight is over the tolerance limit, compensation will be performed according to the setup in the configuration (At the end, Off, Immediately).

When the compensation is active (At the end or Immediately), if the component added is within tolerance the capacity bar is always in green color.

If one component added is outside the tolerance, the scale will do compensation for next items. In this case, the value displayed is not actual weight and the capacity bar will turn red.

To finish the formulation, press the button corresponding to the icon \rightarrow and add the last component.

Then the formulation will finish and a Formulation Result screen is displayed.

Formu	lation Re	sult		
ltem	PN	Name	Formu. Wt	Actual Wt.
001	11	comp.1	50.0	51.3
			e	

To print the formulation result press the button corresponding to the icon

To save the formulation result, press the button corresponding to the icon

To return to the main screen, press the button corresponding to the icon


4.4.2 Recipe Formulation

Make sure the formulation mode is set to recipe (see section 4.4.4 for instructions).

The information line will now show 'Please recall a recipe' Recall a recipe from the Formulation Library by pressing the button . See section 4.10 for instructions on how to create/recall a Library record.

🚺 Formu		Max 6000 g d= 0.1 g 2:00 AM 01/01/1970
Please reca	ll a recipe.	
* G >0<		0.0 g
Factor:	1.00	
Tolerance:	1.00 %	
*	.	

Press the button corresponding to the scan a barcode to start formulation.

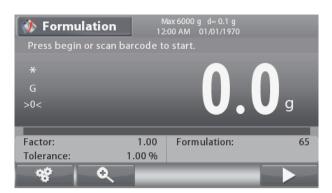

The target weight in each recipe item will be used as preset tare.

Place the required weight on the pan (add weight until the displayed value reaches zero again).

icon or

Press the button corresponding to the icon to confirm the weight for the current component and to continue adding other components or scan another barcode of the next component.

Notes: To terminate the formulation process, press the button corresponding to the **x** icon. If the added weight is over the tolerance limit, compensation will be performed according to the setup in the configuration (At the end, Off, Immediately).

When the compensation is active (At the end or Immediately), if the component added is within tolerance the capacity bar is always in green color.

If one component added is outside the tolerance, the scale will do compensation for next items. In this case, the value displayed is not actual weight and the capacity bar will turn red.

When all the components of the recipe have been added, the formulation will finish and a Formulation Result screen is displayed.

icon to

4.4.3 Factor and Tolerance Setup

Press the button corresponding to the enter the Parameter screen.

Select the list item and press the button corresponding to

the icon _____, to change the setting as desired

using the alphanumerical keypad.

The Component **Factor** can be set to a value between 0.20 and 5.00 with 1.0 being the default.


The Tolerance can be set to a value between 0 and

15.0 % with 5 % being the default.

Press the button corresponding to the

return to the Application Home screen.

Note: Factor and Tolerance can only be set after the formulation has started. Tolerance is +/-, for example: Tolerance = 5 % means that the tolerance is the range -5 % ~ +5 %.

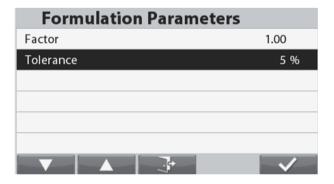


🐠 Formulati	000 Max 6000 g d 12:00 AM 01/0	
Place 50.0g com	p.1.Press Next Comp. to	continue.
* G >0<	-5	0.0 ,
Factor	1.00	
Tolerance	1.00 % PN:	11
*		\rightarrow ×

4.4.4 Application Setup

The Application can be customized for various user preferences.

Press the button corresponding to the rest icon to enter Configuration.



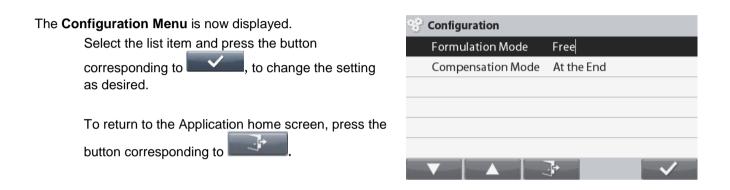

The Formulation Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Formulation Mode	Free, Recipe	To set Mode
Compensation Mode	At the End, Off, Immediately	To set compensation mode


4.4.5 Input/Output (I/O) Setup

The I/O's can be customized for various user preferences.

The I/O's are defined below (defaults in **Bold).**

Note: The I/O's will only work when the I/O Option Board have been installed. See the Accessory list in section 9.4 for information. The option I/O board provides two isolated inputs and four dry-contact normally open relay outputs which can be used for simple process weighing.

Item	Available Settings
Discrete Input 1	Off, Zero, Tare, Clear Tare, Quit, Next Item, Last Item
Discrete Input 2	Off, Zero, Tare, Clear Tare, Quit, Next Item, Last Item
Discrete Output 1	Off, Overload, Underload
Discrete Output 2	Off, Overload, Underload
Discrete Output 3	Off, Overload, Underload
Discrete Output 4	Off, Overload, Underload

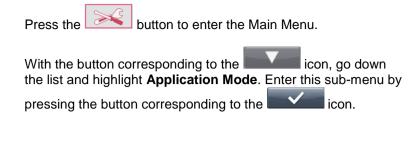

Main Menu	
🚨 Calibration	>
🔀 Setup	≫
📃 Read Out	≫
Figure Application Mode	>
% Weighing Unit	≫
🔙 GLP / GMP Data	>

In the Application Mode menu enter the Formulation sub-menu.

Application Mode	
🍓 Reset	>
ighing Weighing	≻
🔗 Counting	≻
章 Check	≽
🐠 Formulation	≻
% Percent	>

Formulation		
📀 Enable	On	>
🚧 Discrete Input 1	Off	>
🍫 Discrete Input 2	Off	>
🥡 Discrete Output 1	Off	>
🥡 Discrete Output 2	Off	>
🥡 Discrete Output 3	Off	>
	.+	

icon to change the setting as desired.

The Formulation sub-menu is now displayed.

Select the list item and press the button corresponding to the

4.5 Percent Weighing

Use Percent Weighing to measure the weight of a sample displayed as a percentage of a pre-established Reference Weight.

button until **Percent** is displayed in the upper left portion of the home screen. Press the

Establish a reference weight according to section 4.5.1 and then place the objects on the pan to check the percentage.

The default (or last) Reference Weight is displayed.

Note: Refer section 9.5, or press the

% Percent	Max 6000 g d=0.1 g 12:00 AM 01/01/1970	•	The PERCENT Home screer
* G >0<		0%	Main Display Line
Current Wt.: Diff. (wt.):	0.0g Ref Wt.: -10.0g	10.0g	Reference Fields Functions



Application Icon

(i) button for button icon explanation.


4.5.1 Establishing a Reference Weight

There are three ways to establish a reference weight:

 Key in the reference weight value using the alphanumerical keypad and then press the button corresponding to the icon.



- Press the button corresponding to the icon to enter the Edit Reference Weight screen.
 The Edit Reference Weight screen is now displayed.
 Enter the desired value using the alphanumerical keypad and then press the button corresponding to the icon to save and return to the Application home screen.
- Place the reference weight on the pan and press the button corresponding to the icon.

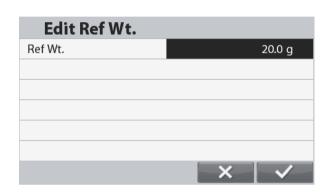

4.5.2 Application Setup

The Application can be customized for various user preferences.

Press the button corresponding to the **enter Configuration**.

% Percent		/ax 6000 g d≕0.1 g 2:00 AM 01/01/1970	
* G >0<			0%
Current Wt.: Diff. (wt.):	0.0g -10.0g	Ref Wt.:	10.0g
* 1			

The **Configuration Menu** is now displayed.

Select the list item and press the button

corresponding to **example**, to change the setting as desired.

To return to the Application home screen, press the button corresponding to

Configurati	on	
Auto Tare	Off	
Chain Tare	On	
Accumulate	Off	

The Percent Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Auto Tare	On, Off	To enable Automatic Tare
Chain Tare	On , Off	To enable Chain Tare (continuous Tare)
Accumulate	Off, Automatic, Manual	To enter Accumulation / Totalization

4.6 Filling

This application allows the user to fill a container to a pre-determined target weight. The progress bar displays the filling status, and within 10 percent of the target value the progress bar converts to fine resolution (+/-10%) for accurate results.

Press the button until **Filling** is displayed in the upper left portion of the home screen. The default (or last) Target weight is displayed. Place objects on the pan to begin.



The FILLING Home screen

Main Display Line

Reference Fields

Functions



Application Icon

Note: Refer section 9.5, or press the *i* button for button icon explanation.

4.6.1 Target Weight and Set Points Setup

There are three ways to set up the Target weight:

1. Place the weight on the pan and press button

corresponding to the icon.

- Key in the target weight value using the alphanumerical keypad and press the button corresponding to the icon
- Press the button corresponding to the Reference (Set Point) icon to enter the Edit Settings screen.

The Edit Settings screen is now displayed.

Press the button corresponding to the **set of** icon to switch between Weight, Tolerance and Percent. Select the list item and press the button corresponding

to the icon **even**, to change the setting as desired using the alphanumerical keypad.

To return to the Application home screen, press the

button corresponding to the icon

Edit Settings	
Target(Wt.)	1000.0 g
SP1(Wt.)	900.0 g
SP2(Wt.)	950.0 g
	S 🗸
Edit Settings	
Edit Settings Target(Wt.)	1000.0 g
	1000.0 g 100.0 g
Target(Wt.)	
Target(Wt.) Target-SP1(Wt.)	100.0 g
Target(Wt.) Target-SP1(Wt.)	100.0 g
Target(Wt.) Target-SP1(Wt.)	100.0 g

Edit Settings	
Target(Wt.)	1000.0 g
SP1	90.00 %
SP2	95.00 %
	5 🗸

4.6.2 Application Setup

The Application can be customized for various user preferences.

Press the button corresponding to the ricon to enter **Configuration**.



The **Configuration Menu** is now displayed.

Select the list item and press the button

corresponding to the icon **example**, to change the setting as desired.

To return to the Application home screen, press the button corresponding to the icon

Configuration		
Auto Tare	Off	
Chain Tare	On	
Accumulate	Off	
	Ţ.	

The Filling Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Auto Tare	On, Off	To enable Automatic Tare
Chain Tare	On , Off	To enable Chain Tare (Continuous Tare)
Accumulate	Off, Manual	To enable Accumulation / Totalization

4.6.3 Input/Output (I/O) Setup

The I/O's can be customized for various user preferences. The I/O's are defined below (defaults in **Bold).**

ltem	Available Settings
Discrete Input 1	Off, Zero, Tare, Clear Tare, Print, Start/Stop
Discrete Input 2	Off, Zero, Tare, Clear Tare, Print, Start/Stop
Discrete Output 1	Off, SP1, SP2, Target, Alarm
Discrete Output 2	Off, SP1, SP2, Target, Alarm
Discrete Output 3	Off, SP1, SP2, Target, Alarm
Discrete Output 4	Off, SP1, SP2, Target, Alarm

Note:

The output will be reset to normally open when both SP1 and SP2 are reached.

The I/O's will only work when the I/O Option Board have been installed. See the Accessory list in section 9.4 for information. The option I/O board provides two isolated inputs and four dry-contact normally open relay outputs which can be used for simple process weighing.

The outputs also only work when the button corresponding to the icon

has been pressed.

Press the

button to enter the Main Menu.

With the button corresponding to the icon, go down the list and highlight Application Mode. Enter this sub-menu

by pressing the button corresponding to the icon.

In the Application Mode menu enter the Filling sub-menu.

Main Menu	
💩 Calibration	≻
🔀 Setup	≻
🔳 Read Out	≻
Figure Application Mode	>
🐕 Weighing Unit	≻
🔙 GLP / GMP Data	≻
	\sim
Application Mode	
Application Mode	>
	>
ing Weighing	> > >
WeighingOunting	> > > >
 Weighing Counting Check 	> > > > >
 Weighing Counting Check Formulation 	> > > > > > >

The Filling sub-menu is now displayed.

Select the list item and press the button corresponding to the

icon to change the setting as desired.

Filling		
📀 Enable	On	>
🚧 Discrete Input 1	Off	≻
🍫 Discrete Input 2	Off	≽
🥡 Discrete Output 1	Off	≻
🧀 Discrete Output 2	Off	≽
Discrete Output 3	Off	≻
	÷.	✓

4.7 Dynamic Weighing

Use this application to weigh an unstable load, such as a moving animal. Three different start/reset modes can be selected: Manual (start and stop via key press), Semi-Automatic (auto-start with manual reset), and Automatic (start and stop automatically).

X

0

to reset.

Press the button until **Dynamic** is displayed in the upper left portion of the home screen.


Press the button corresponding to the icon

to start averaging.

To abort the averaging press the button corresponding to the icon


When the averaging has finished, press the button corresponding to the icon



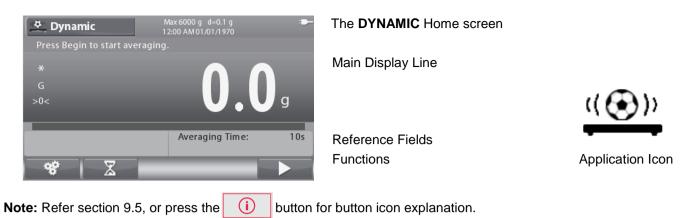

4.7.1 Application Setup

The Application can be customized for various user preferences.

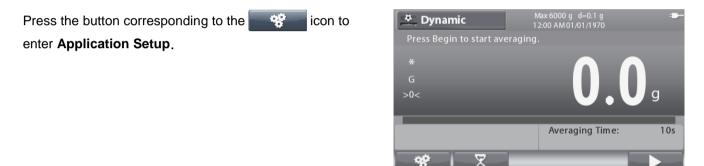

The Configuration Menu is now displayed.	Con
Select the list item and press the button	Dynar
corresponding to	Auto
as desired.	Chain
	Accun
To return to the Application home screen, press the	Durati

button corresponding to


Configuratio Dynamic Mode	Manual	
Auto Tare	Off	
Chain Tare	On	
Accumulate	Off	
Duration time	10	

The Dynamic Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Dynamic Mode	Manual, Semi-Automatic, Automatic	To set the Mode
Auto Tare	On, Off	To enable Automatic Tare
Chain Tare	On, Off	To enable Chain (Continuous) Tare
Accumulate	Off, Automatic, Manual	To enable Accumulate / Totalization
Duration Time	1 10 S	Set the duration time in seconds

4.7.2 Average Time Setup

Press the button corresponding to the enter the **Edit Average Time** screen.

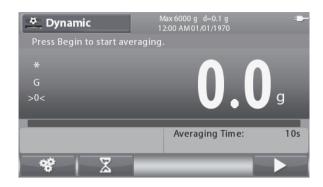

The Edit Average Time screen is now displayed.

Enter the Average Time by using the alphanumerical keypad and press the button

corresponding to the **example** icon to change save the value and return to the Application home screen.

The default Average Time is 10 s.

Note: When the time is set to 0, the first stable weight over 5d will be displayed.

Averaging time can be set to a value between 0 and 60.

4.7.3 Input/Output (I/O) Setup

The I/O's can be customized for various user preferences. The I/O's are defined below (defaults in **Bold).**

Item	Available Settings
Discrete Input 1	Off, Zero, Tare, Clear Tare, Print, Start, Reset
Discrete Input 2	Off, Zero, Tare, Clear Tare, Print, Start, Reset
Discrete Output 1	Off, Underload, Overload
Discrete Output 2	Off, Underload, Overload
Discrete Output 3	Off, Underload, Overload
Discrete Output 4	Off, Underload, Overload

icon to


Note: The I/O's will only work when the I/O Option Board have been installed. See the Accessory list in section 9.4 for information. The option I/O board provides two isolated inputs and four dry-contact normally open relay outputs which can be used for simple process weighing.

Press the button to enter the Main Menu.

With the button corresponding to the **sector** icon, go down the list and highlight **Application Mode**. Enter this sub-menu

by pressing the button corresponding to the **example** icon.

Main Menu	
📥 Calibration	\rightarrow
🔀 Setup	\rightarrow
💷 Read Out	≫
Figure Application Mode	>
8 Weighing Unit	\rightarrow
🔙 GLP / GMP Data	×

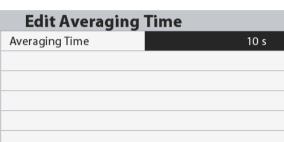

In the Application Mode menu enter the **Dynamic** sub-menu.

The Dynamic sub-menu is now displayed.

Select the list item and press the button corresponding to

the **licon** to change the setting as desired.

Application Mode	
🔗 Counting	≻
🏮 Check	≻
🀠 Formulation	≻
% Percent	≫
🕌 Filling	≻
🙅 Dynamic	>

Dynamic		
📀 Enable	On	>
🚧 Discrete Input 1	Off	>
k Discrete Input 2	Off	>
🍻 Discrete Output 1	Off	>
🥡 Discrete Output 2	Off	>
🥡 Discrete Output 3	Off	>
	÷	\checkmark

4.8 Density Determination

The Ranger 7000 can be used to determine an object's density. Two types of density determination can be made:

- 1. Solids more dense than water
- 2. Solids less dense than water

Press the **Density** is displayed in the upper left portion of the home screen.

Before making density measurements, establish the Application Settings.

Press the button corresponding to the icon **Example** to start.

Check the object weight in air and when prompted press the button corresponding to the icon

 \checkmark

Check the object weight again when it is submerged in the liquid and when prompted press the button

corresponding to the icon . The density of the object will be displayed.



The **DENSITY** Home screen

Main Display Line

Reference Fields Functions



Application Icon

Notes:

Refer section 9.5, or press the button for button icon explanation.

RANGER[®] 7000 SCALES

4.8.1 Application Setup

The Application can be customized for various user preferences.



The Density Determination Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Liquid Type	Water, Other*	To set the Liquid type
Temperature Type	⁰C, ⁰F	To set the Temperature Type

Note: * Other liquids that are not water.

4.8.2 Water Temperature / Liquid Density Setup


To set the water temperature or Liquid density (other liquids than water), please follow the instructions below.

Liquid type: Water

Press the button corresponding to the _____ icon to

enter the Enter Water Temperature screen.




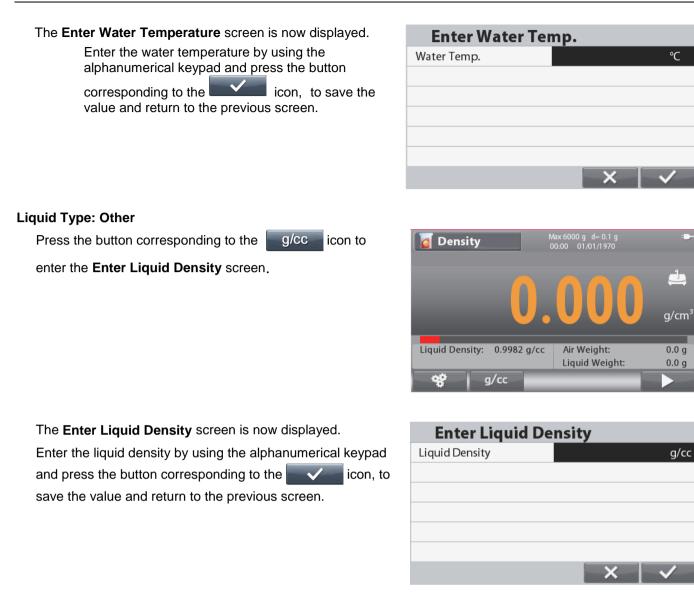

4.9 Differential Weighing

Differential weighing stores weight values of the samples. The samples can then be dried or processed and the difference in weight calculated. Up to 20 samples can be stored.

Press the Button until **Differential** is displayed in the upper left portion of the home screen.

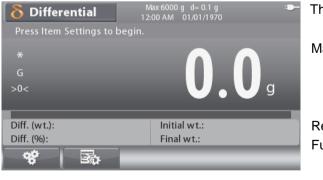

The DIFFERENTIAL Home screen

Main Display Line

Reference Fields Functions




Note: Refer section 9.5, or press the **(i)** button for button icon explanation.

4.9.1 Application Setup

The Application can be customized for various user preferences.

Press the button corresponding to the	**	icon to
enter Configuration.		



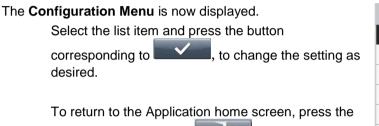

button corresponding to

Configurati	on	
Auto Tare	Off	
Chain Tare	On	
		\checkmark

The Differential Configurations are defined below (defaults in Bold).

Item	Available Settings	Comments
Auto Tare	Off, On	To set the Automatic Tare
Chain Tare	On, Off	To set the Chain Tare

4.9.2 Differential Operation

To start differential, please follow the instructions below.

Press the button corresponding to the signal icon to enter **Edit Item**.



The Edit Item Menu is now displayed

Press to add a new item. A maximum of 20 items can be created.

Press , the current item is selected and the scale returns to the main screen to start differential weighing. Press to edit the name of the item.

Note: All data will automatically be cleared when scale is powered Off.


An item must be selected to start differential operation.



4.10 Sieve Weighing

Sieve analysis (or gradation test) is a practice or procedure used to assess the particle size distribution (also called gradation) of a granular material. It can be performed on any type of non-organic or organic granular materials including sands, crushed rock and aggregates, clays, granite, feldspars, asphalt, concrete, coal, soil, as well as a wide range of manufactured powders, grain and seeds.

Press the Button until **Sieve** is displayed in the upper left portion of the home screen.

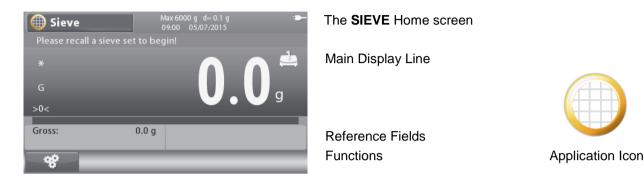

Note: Refer section 9.5, or press the **(i)** button for button icon explanation.

4.10.1 Application Setup

The Application can be customized for various user preferences.



qĝ

The **Configuration Menu** is now displayed.

Select the list item and press the button

corresponding to the icon, to change the setting as desired.

To return to the Application home screen, press the button corresponding to the icon.

Configuration	1 All All All All All All All All All Al	
Acc. % retained	Off	
Acc. Wt. retained	Off	
Fineness	Off	
Calculate by	End Weight	
	3	

The Sieve Configurations are defined below (defaults in **Bold**).

Item	Available Settings	Comments
Acc. % retained	Off, On	Print Accumulated % retained (on / off)
Acc. Wt. retained Off , On Print Accumulated weight retained (on / of		Print Accumulated weight retained (on / off)
Fineness	Off, On	Print Fineness Modulus (on / off)
Calculate by	End Weight, Start Weight	Calculate result with End Weight or Start Weight

Note: * If Start Weight is chosen, you must weigh original sample (or input manually).

RANGER[®] 7000 SCALES

4.10.2 Sieve Operation

To start sieve operation, please follow the instructions below.

Recall a sieve set from library to begin.

Note: A sieve set must be in library for the sieve application to work. Each Sieve to be used has to be added to the set, even if they are not used for Fineness Modulus calculation, as well as the Pan (with mm size 0). Sieve Weighing always assumes that the procedure will be from the grossest sieve (largest size) down to the finest sieve (the pan). To create a sieve set, see section 4.11.

Press the button corresponding to the icon to

start Sieve weighing.






Enter a sample ID if needed.

Note: The sample ID can be up to 30 alphanumeric characters and can be printed on the output template.

Weigh, or input manually, the original sample as Start Weight if needed.

Note: This screen will not show if Start Weight is chosen for calculation in **Configuration**.

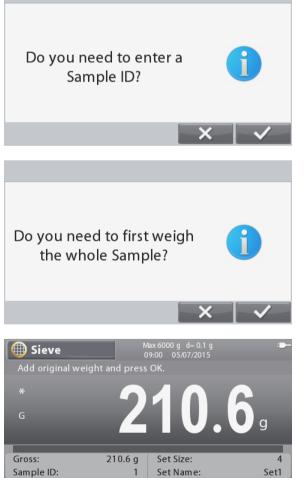

Щi.

Add Start Weight and press the button corresponding to the icon.

Alternatively, press the button corresponding to the icon.

A numeric input screen appears.

Key in the Start Weight using the alphanumerical keypad,

then press the button corresponding to the **example** icon.

 
EN-40

corresponding to the

analysis.

tare.

RANGER[®] 7000 SCALES



After processing or shaking is completed, press the button

Place container on pan. The scale will then perform an auto

Empty sieve contents in to the container and press the

Note: Press the button corresponding to the

to cancel current process if needed.

button corresponding to the

icon to begin Sieve

X

icon









After all sieves have been weighed, the result screen will be displayed.

To print the Sieve Result, press the button corresponding to

the icon 📥 or the button

To return to the main screen, press the button

corresponding to the icon

	Sieve	Result		
Item	Sieve	retained	% retained	% passed
04	1"	33.7 g	20.01%	79.99%
03	#4	71.6 g	42.52%	37.47%
02	4mm	21.1 g	12.53%	24.94%
01	Pan	42.0 g	24.94%	0.00%

è.

Note: Print template **Custom 5** is set as default template for Sieve Weighing. See Section 6.6 for a sample of a full sieve template output.

icon.

4.11 Library

When an item is processed on a regular basis, the item's data may be stored in memory for future use. This memory is referred to as the Scale's Library.

The following data is stored for the Application used:

Application	PN (Part Number)	Name	Preset Tare	APW	Ref./Target Weight	Check Limits	SP (Set Points)	Sieve Size Calculate FM	Max Records
Weighing	х	х	х						2000
Counting	х	х	х	х					2000
Percent	N/A					х			
Check	х	х	х	х		х			2000
Dynamic	N/A					х			
Filling	х	х	х		х		х		2000
Formulation	х	х	х		х				30
Differential	N/A						х		
Density	N/A					х			
Sieve		х						х	30


Notes: Maximum length of PN and Name is 30 characters.

For the Formulation library, each record can store up to 100 components.

For the Sieve library, each record can store up to 10 sizes.

4.11.1 Creating a Library Record

To create a Library record, press the Library button . The requested data records will appear according to the active application mode (see section 4.10 above). In this example the Weighing Library screen is now displayed.

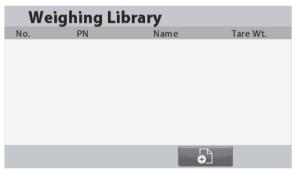


The New Library Item screen is displayed

New Library Item 001	
PN	
Name	
Tare Wt.	g

Press the button corresponding to the

To return to the previous screen press the Library button again.

 To add a Library record, press the button corresponding to the icon



Repeat the process to enter Name, Tare Weight and other

values by using the button corresponding to **move** to move down in the list.

icon to go back to Library List screen.

Edit Sieve	
Unit	mm
Value	
Calculate FM	Off
Display Value	Pan
Value(mm)	0.000 mm

Sieve Weighing: Sieves in a set can be entered as a mix of inch, # and mm or cm sizes, but the Ranger 7000 uses mm measurements for all of its calculations.

Each individual Sieve can be edited so that the following information is associated with the Sieve:

Unit – the Sieve gradiation in inches, #, cm or mm Value – the numeric value for the unit (ex.: a "3" for a 3 inch sieve).

Calculate FM – will the individual Sieve be used to calculate the Modulus of Fineness?

Display Value – how the individual Sieve will be shown on the Sieve Set summary in the Library.

Value(mm) – The conversion of the Value and Unit for the Sieve into mm.

Once all Sieves in at least one Sieve Set has been added to the Library under Sieve Weighing, the Sieve Weighing Mode can be used.

4.11.2 Retrieving a Library Record

To load a Library record from the home screen

press the button.

The Weighing Library screen is now displayed.

Use numeric keyboard to search the library. For example,

key in 111 will lead you to the library ID:111 (If existed).

Then press the button corresponding to the icon

to load the Library data and return to the Application mode related to the Library record.

Note: Scanning a barcode twice will retrieve the library record directly.

4.11.3 Editing a Stored Library Record

To delete a stored record, follow "Retrieving a Library Record" above.

Use the buttons corresponding to the icons

to move up and down in the list and highlight the Library item to be edited.

Then press the button corresponding to the icon

The Edit Library Item screen will be displayed. Make the necessary changes and the press the button

corresponding to the icon to return to the Library List.

4.11.4 Deleting a Stored Library Record

To delete a stored record, follow "Editing a Stored Library Record" above.


Press the button corresponding to the icon **and the icon**. A new screen will be displayed asking for confirmation.

Press the button corresponding to the icon to delete the record, or press the button corresponding to the

icon

to go back to the previous screen.

We	ighing Li	ibrary	
ID	PN	Name	Tare Wt.
0001	22	266	

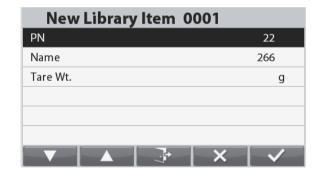



Additional Features 4.12

 
4.12.1 Weigh Below

The Ranger 7000 Scale is equipped with a weigh below hook for weighing below the scale.



CAUTION: Make sure that the scale is properly supported so that it cannot fall or detach during use of the Weigh below feature. Failure to follow these instructions could result in personal injury and damage to the equipment.

To use this feature, remove power from the scale, then remove the protective cover for the weigh below opening (2 screws). The protective cover is reversible for easy storage.



The scale can be supported using lab jacks or any other convenient method. Ensure the scale is level and secure. Power on the Scale, then use an appropriate string or wire to attach items to be weighed.

5. **MENU SETTINGS**

5.1 Menu Navigation

button from any Application Home screen. To enter the Main Menu, press the


Main Menu	
📥 Calibration	≫
🔀 Setup	≻
💷 Read Out	≻
Pication Modes	≻
19 Weighing Units	≻
🔙 GLP and GMP Data	≻
	\sim

Changing Settings

button.

To change a menu setting, navigate to that setting using the following steps:

Enter the Menu

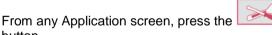

The Main Menu List appears on the display.

Select the Sub-Menu

Scroll to the desired Sub-menu in the Main Menu List by using the button corresponding to the icon



Press the button corresponding to the icon

to display the Sub-menu items.

Application Modes	
쓶 Reset	>
轖 Weighing	≻
🕅 Parts Counting	>
章 Check Weighing	>
🗲 Formulation	>
% Percent Weighing	>

Select the Sub-Menu Item


Scroll to the desired Sub-menu Item using the button corresponding to the icon

Press the button corresponding to the icon to view the Sub-menu item's settings.

Select the Setting.

Scroll to the desired Setting using the button corresponding to the icon



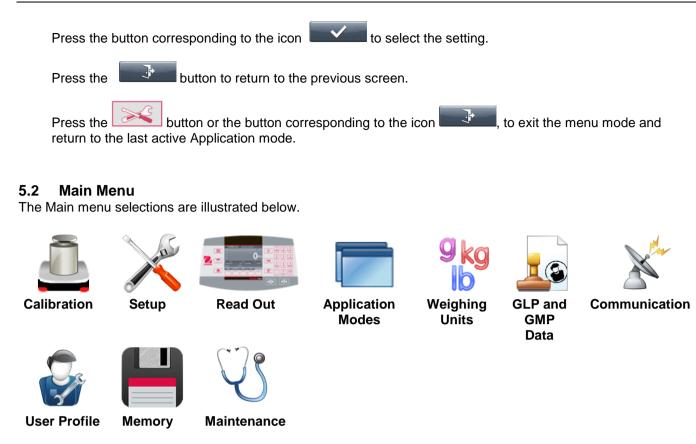

5.3 Calibration

R71MD models offer three calibration methods: Zero Calibration, Span Calibration and Linearity Calibration.

R71MHD models offer 5 calibration methods: Zero Calibration, Span Calibration, Linearity Calibration, Internal Calibration and Automatic Calibration.

Do not disturb the scale during any calibration.

5.3.1 Calibration sub-menu

R71MD models:





Zero Calibration

Span Calibration



Linearity Calibration



GEO

R71MHD models:



Zero

Calibration





Calibration

Automatic

 


Linearity

Internal Calibration

Calibration*

AutoCal[™] Adi



5.3.2 **Zero Calibration**

Span

Calibration

Use this calibration method to adjust the zero calibration point, without affecting the span or linearity calibration.

Note: Zero Calibration is only available on 2nd platform.

5.3.3 **Span Calibration**

Span calibration uses two calibration points, one at zero load and the other can be chosen by the user by using the numerical keypad.

With the scale turned ON and no load on the pan, start Span Calibration to initiate the procedure. Additional calibration values to be used are shown on the display. The best accuracy is achieved using the mass closest to the full span value.

5.3.4 Linearity Calibration

Linearity calibration uses three calibration points, one at zero load and the others at specified loads. Refer to Table 5.1 for Linearity values.

Model	Linearity Calibration Points	Weight Class	
R71MHD3	0 kg, 1.5 kg, 3 kg	ASTM Class 2	OIML F1
R71MHD6	0 kg, 3 kg, 6 kg	ASTM Class 2	OIML F1
R71MHD15	0 kg, 10 kg, 15 kg	ASTM Class 2	OIML F1
R71MHD35	0 kg, 20 kg, 35 kg	ASTM Class 2	OIML F1
R71MD3	0 kg, 1.5 kg, 3 kg	ASTM Class 5	OIML M1
R71MD6	0 kg, 3 kg, 6 kg	ASTM Class 5	OIML M1
R71MD15	0 kg, 10 kg, 15 kg	ASTM Class 5	OIML M1
R71MD35	0 kg, 20 kg, 35 kg	ASTM Class 5	OIML M1
R71MD60	0 kg, 30 kg, 60 kg	ASTM Class 5	OIML M1

TABLE 5-1 Calibration Masses

5.3.5 Internal Calibration (R71MHD models)

Calibration is accomplished with the internal calibration mass. Internal calibration can be performed at any time, provided the scale has warmed up to operating temperature and is level.

With the Scale turned ON and no load on the pan, select Internal Calibration. The Scale begins to calibrate.

The display shows the status, then returns to the current application.

To cancel at any time, press

5.3.6 Automatic Calibration (R71MHD models)

When Automatic Calibration is set ON, the scale performs a self-calibration:

- when it senses a temperature change of 1.5°C
- or every 11 hours

AutoCal will automatically calibrate the Scale (using the internal mass) each time there is a change in temperature significant enough to affect accuracy.

Note: * Automatic Calibration function is only available in certain regions.

5.3.7 AutoCal[™] Adj (Adjustment)

Use this calibration method to adjust the span calibration point, without affecting the span or linearity calibration. Calibration Adjust may be used to adjust the result of the Internal Calibration by +100 divisions.

Note: Before making a calibration adjustment, perform an Internal Calibration. To verify whether an adjustment is needed, place a test mass equal to the span calibration value on the pan and note the difference (in divisions) between the nominal mass value and the actual Balance reading. If the difference is within +1 division, calibration adjustment is not required. If the difference exceeds +1 division, calibration adjustment is recommended.

Example:	
Actual weight reading:	200.014
Expected weight reading:	200.000 (Test mass value)
Difference Weight (d):	0.014
Difference weight in digits:	–14 (Adjust value)

To perform a Calibration Adjustment, touch AutoCal Adjustment from the Calibration Menu; Enter the value (positive or negative divisions) to match the difference noted earlier in the procedure.

Recalibrate using Internal Calibration. After calibration, place the test mass on the pan and verify that the mass value now matches the displayed value. If not, repeat the procedure until Internal Calibration reading agrees with the test mass.

Once completed, the balance stores the Adjustment value and the display returns to the current application.

5.3.8 GEO Adjustment

Enter this sub-menu to set the GEO values.

Press the button corresponding to the icon to adjust the GEO value.

Calibration	
🛜 Zero Calibration	
💦 Span Calibration	
👘 Lin. Calibration	
GEO Adjustment 12	>

Choose the correct GEO value and press the button

corresponding to the icon to confirm.

The values range from 0-31.

GEO	Adjustment
7	
8	
9	
10	
11	
12	

Note: GEO is only available in R71MD models. See table 9-3 for GEO values.

 \checkmark

5.4 Setup

Enter this sub-menu to customize Scale display functionality.

5.4.1 Scale Setup sub-menu



Factory default settings are shown below in bold.



5.4.2 Reset

Reset all settings to factory default settings.

```
= Reset.
```

Do not reset and return to Setup menu screen.



5.4.3 Language Set the language displayed for menus and displayed messages. English

Spanish German French Italian Chinese Korean Polish Portuguese Japanese



5.4.4 Power On Unit

Set the unit that will be displayed at Power On.

Auto Kilogram Pound Gram Ounce Pound:Ounce Custom Unit



5.4.5 Power On Zero

Zero the balance at Power On. OFF = disabled. **ON** = enabled.



5.4.6 Key Beep

Set whether or not the beeper sounds when a button is pressed.

OFF = disabled. **ON** = enabled.



5.4.7 Expand Display

Set the expand display resolution. When set to x10, the display resolution will be enlarged 10 times.

- OFF **x10**
- x20

Example:

For the 35kg x 5g model:

When set to x10, the display resolution will be 35kg x 0.5g.

When set to x20, the display resolution will be 35kg x 0.2g.

Notes:

x20 is not available in high resolution models.

When the scale is used in Legal for Trade the setting will be forced to OFF and it will not be changeable.



5.4.8 Barcode Rule

The barcode rule validates a scanned barcode number. Two different rules can be set. If both rules are enabled, any barcode that match either rule 1 or rule 2 will be accepted by the scale.

Match Rule 1 OFF = disabled. ON = enabled.

Match Rule 2 OFF = disabled. ON = enabled.

Example 1:

Barcode Rul	e	
Match Rule1	On	\rightarrow
Rule1		
Match Rule2	Off	>

In this example the barcode rule is set to '......'. This means that any barcode that is 8 characters long will be accepted by the scale, regardless of what the individual characters are.

Example 2:

Barcode Rul	e	
Match Rule1	On	≫
Rule1	55	
Match Rule2	Off	>
	×	

In this example the barcode rule is set to '.....55'. This means that any barcode that is 7 characters long and ending with the numbers '55' will be accepted by the scale.

Note: The barcode rule is only functional when connecting a barcode scanner through the USB host.

Since there are many brands of Barcode scanners in the market, OHAUS tested and confirmed that below Barcode scanners from Datalogic are compatible with Ranger7000:

Heron series QuickScan series Gryphon 4100 series Gryphon 4400 series

Honeywell barcode scanner can also be supported by following below steps:

1. Make sure the barcode scanner is set as USB PC Keyboard

Setup Barcode scanner as USB PC Keyboard according to the barcode scanner's manual.



Make sure the barcode scanner is set with a carriage return after the bar code according to the barcode scanner's manual.



Please refer to the barcode scanner manual for supported barcode types. The barcode will be stored as PN (Part Number) in the library. The maximum length of the barcode (PN) is 30 characters.

5.5 Read Out

Enter this sub-menu to customize Scale display functionality.

Scale Read Out sub-menu



Factory default settings are shown below in bold.



5.5.1 Reset

Reset all settings to factory default settings.



Yes = Reset. No = Do not reset and return to Read Out menu screen.

	5.5.2 Stability Set the amount the reading can vary while the stability symbol remains on.
, building and	0.5 Division = 0.5 graduations 1 Division = 1 graduation 2 Division = 2 graduations 5 Division = 5 graduations
	Note: The setting is forced and locked to 1 Division when the Security Switch is set to the locked position.
⊳O ∢	 5.5.3 Zero Range Set the percentage of scale capacity that may be zeroed. 2%
	 10% Note: The setting is forced and locked to 2% when the Security Switch is set to the locked position.
	5.5.4 Filter level Set the amount of signal filtering.
	LOW= faster stabilization time with less stability.MEDIUM= normal stabilization time with normal stability.HIGH= slower stabilization time with more stability.
	Note: The setting is at the current setting when the Security Switch is set to the locked position.
AZT	5.5.5 Auto Zero Tracking Set the automatic zero tracking functionality.
	OFF = disabled. 0.5 Division = display maintains zero up to a drift of 0.5 graduation per second
	1 Division = display maintains zero up to a drift of 1 graduation per second.
	3 Division = display maintains zero up to a drift of 3 graduations per second.
	Note: The setting is forced and locked to 0.5 Division when the Security Switch is set to the locked position.



5.5.6 **Brightness**

5.5.8

Set the display brightness using the numerical keypad.

20...80...100

5.5.7 Auto Dim (minutes)

Set whether the display dims after x seconds/minutes.

OFF = disabled. 1...30 (minutes)



Auto Sleep (minutes) Set whether the display enters sleep mode after x seconds/minutes.

OFF = disabled. 1...100 (minutes)





5.6 Application Mode

Enter this sub-menu to enable or disable the desired Scale Applications. Only one application can be running at a time.

Note: The use of each Application is described in detail in Section 4.

5.6.1 Turning an Application ON/OFF

Application Mode	
🍊 Reset	\rightarrow
轖 Weighing	>
🔗 Counting	\rightarrow
章 Check	\rightarrow
🀠 Formulation	\rightarrow
% Percent	×
	\sim

Highlight the application by pressing the buttons
corresponding to the icons and then press the button corresponding to the icon
to enter the selected submenu.

In the Item option screen, enter the **Enabled** menu to turn it on or off.

Once an Application is enabled (turned on) it may be chosen by pressing the **Applications** button until it's icon appears in the upper left corner of the home screen. The current menu item status is shown: OFF = disabled, **ON** = enabled

5.7 Weighing Units

Enter this sub-menu to activate the desired units of measure.

Note: Due to national laws, the scale may not include some of the units of measure listed.

5.7.1 Units Sub-menu



Note: The setting is locked when the Security Switch is set to the locked position.

Custom Unit

Use the Custom Unit to display weight in an alternative unit of measure. The custom unit is defined using a conversion factor, where the conversion factor is the number of custom units per gram expressed in scientific notation (Factor x 10^AExponent).

Factor

Set the conversion factor using the numeric keypad.

Settings of 0.1000000 to 1.9999999 are available. The default setting is 1.0000000.

Exponent

Set the factor multiplier.

- -3 =divide the Factor by 1000 (1x10⁻³)
- -2 = divide the Factor by 100 (1x10⁻²)
- -1 = divide the Factor by 10 (1x10⁻¹)
- 0 = multiply the Factor by 1 (1x10⁰)
- 1 = multiply the Factor by 10 (1x10¹)
- 2 = multiply the Factor by 100 (1x10²)

Least Significant Digit

Set the graduation.

Settings of 0.5, 1, 2, 5, 10, 100 are available.

The Custom Unit's name can be customized up to 3 characters.

Note: Custom Unit is locked at Off position when the Security Switch is set to the locked position.

5.7.2 Reset

To reset the unit settings to factory default settings select Reset and then confirm either Yes or No.

Turning a Unit ON/OFF 5.7.3

Select the desired unit, then press the button corresponding to

the icon and then choose either On or Off.

The current menu item status is shown.

= disabled OFF

ON = enabled

Weighing	Unit	
kg kilogram	On	>
b pound	Off	>
g gram	On	>
OZ ounce	Off	>
b:ozlb:oz	Off	>
C Custom Unit		>
		~

Project ID

5.8 GLP and GMP Data

Enter this menu to set the Good Laboratory Practices (GLP) and Good Manufacturing Practice data.







Time Format

Reset

Date Format



Time

Scale ID

GLP Data Sub-menu



5.8.1 Reset

Resets the settings to factory default settings. Reset the settings to factory default settings.



5.8.2 **Date Format**

Set the scale date format.

MMDDYYYY = Month Day Year (default) DDMMYYYY = Day Month Year YYYYMMDD = Year Month Day



5.8.3 Date

Set the current date using the alphanumeric keypad.



Time Format 5.8.4

Set the scale time format. 24H = 24 hour format (default) 12H = 12 hour format



5.8.5 Time Set the current time.



5.8.6 Project ID

Set the project ID by using the alphanumerical keypad.



5.8.7 Scale ID

Set the scale ID by using the alphanumerical keypad.

5.9 Communication

Enter this menu to define external communication methods and to set printing parameters. Data may be output to either a printer or PC (see section 6.5 for output string). Factory default settings are shown in bold.

Communication Sub-menu



Choosing an item brings up another menu level (RS232 shown):



Choosing an item brings up yet another menu level, the device settings are dependent on the COM chosen (RS232 shown).

Configuration Menu: (RS232 shown)



5.9.1 Reset

Resets the settings to factory default settings. Reset the settings to factory default settings.



5.9.2 Baud Rate

Set the baud rate (bits per second).

300
600
1200
2400
4800
9600
19200



5.9.3 Parity Set the data bi

ne data bits and	parity.
7 EVEN	= 7 data bits, even parity
7 ODD	= 7 data bits, odd parity
7 NONE	= 7 data bits, no parity
8 NONE	= 8 data bits, no parity



5.9.4 Stop Bits Set the stop bits. 1 BIT 2 BIT

5

5.9.5 Handshake

Set the flow control method. **NONE** = no handshaking XON/XOFF = XON/XOFF handshaking HARDWARE = hardware handshaking (COM1 menu only)

5.9.6 Alternate Command



Enter this sub-menu to set a different command character for the P (Print), T(Tare) or Z(Zero)



5.9.7 **Reference Balance**

Off = do not connect to reference balance

On = connect to reference balance

Note: Use reference balance to perform sampling with high resolution balance in Counting Mode. Please make sure the balance is already switched on before connecting to Ranger 7000.

Alternate Print Command

Set the alternate command character for Print.

Settings of A(a) to Z(z) are available, except T&Z. The default setting is \mathbf{P} .

Alternate Tare Command

Set the alternate command character for Tare.

Settings of A(a) to Z(z) are available, except P&Z. The default setting is T.

Alternate Zero Command

Set the alternate command character for Zero. Settings of A(a) to Z(z) are available, except P&T. The default setting is Z.

Print Setup Menu: (RS232 shown)



5.9.8 Reset

Resets the settings to factory default settings. Reset the settings to factory default settings.



5.9.9 **Stable Weight Only**

Set the printing criteria.

- OFF = values are printed immediately, regardless of stability. ON = values are printed only when the stability criteria are met.

5.9.10 SICS

Off = disable MT-SICS command On = enable MT-SICS command



5.9.11 Print Options

Set the printing criteria. PC = Print data to a PC Printer = Print data to a printer



5.9.12 Auto Print

Set the automatic printing functionality. Auto P

Print Mode	
OFF	= disabled
ON STABLE	= printing occurs each time the stability criteria are met.
INTERVAL	= printing occurs at the defined time interval.
ACCEPT	= printing occurs each time the display is within the Checkweigh accept
	range and stability criteria are met.
CONTINUOUS	- printing accurs continuously

CONTINUOUS = printing occurs continuously.

When ON STABLE is selected, set the time interval using the numeric keypad. LOAD

= prints when the displayed load is stable

LOAD ZERO = prints when the displayed load or zero reading is stable.

When INTERVAL is selected, set the time interval using the numeric keypad.

Settings of 1 to 50000 seconds are available.

Note: Pressing the print button when INTERVAL has been selected will print the displayed result immediately.

Continuous

OHAUS	= Compatibility with OHAUS products that require real-time weight data
MT Standard	= Compatibility with METTLER TOLEDO products that require real-time
	weight data

Checksum

Off = disabled On = enabled

MT Standard Continuous Output

A checksum character can be enabled or disabled with continuous output. The data consists of 17 or 18 bytes as shown in

Table 5-1.

Non-significant weight data and tare data digits are transmitted as spaces. The continuous output mode provides compatibility with OHAUS products that require real-time weight data. Table 5-1 shows the format for the standard continuous output.

Table 5-1:	Standard	Continuous	Output Format	

		Statu	S ²		Indicated Weight ³			Tare Weight ⁴										
Character	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18
Data	STX ¹	SB-A	SB-B	SB-C	MSD	-	-	-	-	LSD	MSD	-	-	-	-	LSD	CR⁵	CHK ⁶

Continuous Output Format Notes:

- 1. ASCII Start of Text character (02 hex), always transmitted.
- 2. Status bytes A, B and C. Refer to Table 5-2, Table 5-3, and Table 5-4 for details of the structure.
- 3. Displayed weight. Either gross or net weight. Six digits, no decimal point or sign. Insignificant leading zeroes are replaced with spaces.
- 4. Tare weight. Six digits of tare weight data. No decimal point in field.
- 5. ASCII Carriage Return <CR> character (0D hex).
- 6. Checksum, transmitted only if enabled in setup. Checksum is used to detect errors in the transmission of data. Checksum is defined as the 2's complement of the seven low order bits of the binary sum of all characters preceding the checksum character, including the <STX> and <CR> characters.

Table 5-2, Table 5-3, and Table 5-4 detail the status bytes for standard continuous output.

Bits 2, 1, an	Bits 2, 1, and 0								
2	1	0	Decimal Point Location						
0	0	0	XXXXX00						
0	0	1	XXXXX0						
0	1	0	XXXXXX						
0	1	1	XXXXX.X						
1	0	0	XXXX.XX						
1	0	1	XXX.XXX						
1	1	0	XX.XXXX						
1	1	1	X.XXXXX						
Bits 4 and 3	3								
4		3	Build Code						
0		1	X1						
1		0	X2						
1		1	X5						
Bit 5			Always = 1						
Bit 6			Always = 0						

Table 5-2: Status Byte A Bit Definitions

Table 5-3: Status Byte B Bit Definitions

Status Bits	Function
Bit 0	Gross = 0, Net = 1
Bit 1	Sign, Positive = 0, Negative = 1
Bit 2	Out of Range = 1 (Over capacity or Under Zero)
Bit 3	Motion = 1, Stable = 0
Bit 4	lb = 0, kg = 1 (see also Status Byte C, bits 0, 1, 2)
Bit 5	Always = 1
Bit 6	Zero Not Captured after power-up = 1

Bits 2, 1, and 0		nd 0	Weight Description			
2	1	0	Weight Description			
0	0	0	lb or kg, selected by Status Byte B, bit 4			
0	0	1	grams (g)			
0	1	0	metric tons (t)			
0	1	1	ounces (oz)			
1	0	0	not used			
1	0	1	not used			
1	1	1	tons (ton)			
1	1	1	no units			
Bit 3			Print Request = 1			
Bit 4			Expand Data x $10 = 1$, Normal $= 0$			
Bit 5			Always = 1			
Bit 6			Always = 0			

Table 5-4: Status E	Byte C Bit Definitions
---------------------	------------------------



5.9.13 Select Template

This sub-menu is used to define the format of the data output to a printer or computer.

Simple = only prints result and unit

Custom 1 = customized printout format. If not customized, Simple template will be used Custom 2 = customized printout format. If not customized, Simple template will be used Custom 3 = customized printout format. If not customized, Simple template will be used Custom 4 = customized printout format. If not customized, Simple template will be used Custom 5 = customized printout format. If not customized, Simple template will be used Example (Simple Template):

Select Template	
Simple	0.000 kg
Custom 1	No.
Custom2	-JIG.
Custom3	20
Custom4	Y.
Custom5	



5.9.14 Edit Template

This sub-menu is used to edit the current Print template. Each template supports up to 50 data fields to define the format of the data output.

Edit Template Sim	
✓ Field 1 >>	0.000 kg
✓ Field 2	N.
✓ Field 3	-JIG.
✓ Field 4	~(0)
✓ Field 5	Υ.
✓ Field 6	
	\checkmark

To format a template, first select the field number (from 1 to 50). A content window is displayed for the selected field.

Field 1	
3 spaces	
10 spaces	
15 spaces	
Result	
Displayed Weight	
Gross	

Item	Length		ltem	Length
3 spaces	3	String 1		Up to 40
10 spaces	10	String 2		Up to 40
15 spaces	15	String 3		Up to 40
Date	10	String 4		Up to 40
Displayed Weight	23	String 5		Up to 40
Displayed Number	13	String 6		Up to 40
End of Template	0	String 7		Up to 40
Gross	23	String 8		Up to 40
User ID	Up to 12	String 9		Up to 40
Net	23	String 10		Up to 40
New Line (<cr><lf>)</lf></cr>	2	Tare		23
Information	No fixed length	Time		5 or 8 (12 hour format)
Project ID	Up to 40	Alibi ID		6
Serial Number	10	Accumulatio	n	No fixed length
Scale ID	Up to 40	Library ID		4
Result	23 or 29 (Check mode)	Library Nam	e	Up to 30
Mode	Up to 14	Input status		2(00)
PN	Up to 30	Output statu	S	4(1111)

See section 6.6 for sample printouts.

Terminating a template

To terminate a template, an End of Template field must be included. All fields after the End of Template field will be ignored. If a field is chosen as End of Template, the \checkmark will be removed from this field as shown below.

Field 2	Edit Template Simple	
Displayed Weight	✓ Field 1 > 0.000 kg	
Gross	Field 2	
Net	Field 3	
Tare	Field 4	
New Line	Field 5	
End of Template	Field 6	



5.9.15 Edit String

Up to 10 Strings can be edited using the alphanumerical keypad.



5.9.16 Data Transfer

Output weighing results directly to a PC application. Setup is easy and no additional software is required.

Note: Data Transfer Function is not supported in Windows[®] 7/8. OHAUS provides SPDC software for Windows 7/8 users.

OFF= do not print.ON= print the specified settings.

Click the Start Menu in Windows XP system and click "Settings" ->open Control Panel.

Double click Accessibility Options in Control Panel.

File Edit View Favor	tes Tools Help		
🜀 Back 🕤 🌍 🕆 ಶ	🔎 Search 🜔 Folders 🛄		
Address 🕞 Control Pane	and the second se	Accessibility Options Keyboard Sound Display Moure General Stackforg Use Stackforg / you want to use SHIFT, CTF Windown look to be presenting one key at a ter Use Stackforge Pleafag Use Stackforge Pleafag Use FilterKay Toggef opt Use Toggef opt Use Toggef opt Use Toggef opt Use Toggef opt	settings stell or repeated Settings
	Intel(R) GMA Driver for № Dinternet Options Java ≫Keyboard	Show extra keyboard help in programs	
	Cheyboard	OK Cance	Apply

Select the **General** tab in Accessibility Options.

Check Use Serial Keys, and click the Settings button.

Select the Serial Port, and set the Baud rate to 9600.

yboard Sound Display Mouse General	Settings for Ser	ialKeys ? 🕽
Automatic reset Turn off accessibility features after idle for: 5 minutes	Choose the port where you connected out	
Notification	COM1	9600
Give warning message when turning a feature on		
Make a sound when turning a feature on or off		
		OK Cancel
SerialKey devices		
SenalKey devices SenalKey devices allow alternative access to keyboard and mouse features.	SerialKey devices allow altern mouse features.	ative access to keyboard and
SerialKey devices allow alternative access to keyboard and mouse features.		ative access to keyboard and
SerialKey devices allow alternative access to keyboard and mouse features.	mouse features.	
mouse features.	mouse features.	Settings

After selecting, click **OK** to close setting for serial keys. Close the Control Panel.


Run Excel[®] to open one blank sheet. Click on the cell where the data is to be placed. At this time, if the scale sends data to the PC through the RS232 port, the data will be put into the cell, and the cursor will automatically move to the next vertical cell.

Note: If the weighing value is a negative number, set the target cell in TEXT format. Otherwise, Excel will not distinguish it as a negative number.

l no

5.10 User Profiles

Create users with user name and password. User Screen

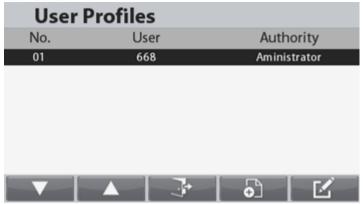

Functions

The User profile is used for saving user specific parameters in menu Total 50 user profiles can be saved in file system User name max length: 12 Password max length: 6 User authorities

- 1. User types
 - a) Administrator
 - Power user b)
 - C) Guest

Notes: Only one Administrator user The first user is always Administrator If no user have been created, login as Administrator.

Administrator Account:

Only the Administrator user can create, delete and edit other users and itself. If an administrator user is deleted, all the power users will also be deleted.

Power User Account:

0

The Power user can only modify the menu settings but cannot create, delete or edit other users or itself.

Guest Account:

36 Login as a Guest user will occur directly when pressing the button corresponding to the icon password is required.

The Guest user can view but cannot modify the general menu settings. All the menus are locked. The Guest user can modify the app configurations but cannot add/edit library records.

Login Screen

Long press the User button to start the User login screen to change the user. Login is also required during power up.

UserLogin	
User	Authority
668	Aministrator
	û - %-

RANGER[®] 7000 SCALES

To login as Adminstrator press the button corresponding to the icon password field. Enter the password associated with the account.

If the wrong password is entered, an error screen will be displayed. Press the button correpsonding to the icon

to return to the login screen.

To login as guest press the button corresponding to the icon

Note: if no user was created, no login is required and automatically login as administrator. Creating a new user

 \mathbf{G} To create a new user, press the button corresponding to the icon

New User
User:
Password:
ConfirmPassword:

Enter the user name and password and press the button correpsonding to the icon to return to the login screen.

Deleting a user

To delete a user, select the user to be deleted in the list and press the button corresponding to the icon

User Profiles				
ID	User	Authority		
01	660	Aministrator		
02	2	Power User		
		•		


m)


In the Edit User screen, press the button corresponding to the icon

EditUser	
User:	2
Password:	**
ConfirmPassword:	**

A confirmation window appears.

  EN-59







Press the button corresponding to the icon to delete the user permanently or to canc deletion and return to User Profiles main screen.

5.11 Memory

5.11.1 USB memory

USB memory is used to store the weight readings for future reference.

In the USB memory menu, set the status to On to enable this feature.

Save to USB	
Off	
On	

By connecting a USB flash drive to the scale the weight readings can now be stored directly on the USB flash drive. The format of the data sent to the flash drive depends on the USB communication setup, please refer to section 5.9 for detail.

The data will be stored in the flash drive in the following location:

<u>\SYSTEM\DATA</u>

A new file will be created monthly (one txt file stores a whole month's output data...)

201606.TXT	2016/6/28 14:26
📄 201607.TXT	2016/7/7 14:25

5.11.2 Alibi memory

Note: This menu is only visible if the Alibi memory hardware option has been installed. See below for installation instructions.

Alibi memory is used to store the weight history for reference. Each Alibi record contains a Record ID, Net Weight value, Tare value and Date & Time.

Enter the Check Records menu item to review the records.

Notes:

The maximum number of record is 262112. When the memory is full and another record is stored the first record will automatically be deleted. At this time a warning message will appear, asking for the user's confirmation.

Alibi Memory	
Check Records	

RANGER[®] 7000 SCALES

The latest record is always displayed on top. Use the buttons corresponding to the icons and to move up and down the list.

Press the button corresponding to the icon to locate a record by entering it's ID No.

Press the button corresponding to the icon to print a range of records.

Press the button corresponding to the icon to return to previous menu.

Note: Only stable weight can be printed to the Alibi memory.

Alibi Memory Option Board Installation

STEP 1. Opening the terminal module

A) Detaching the Terminal from the base.

1. Switch off and disconnect the scale from main power supply.

Ó

2. Detach the display terminal from the base by pressing both release buttons at the same time as show below picture. After that pull the Terminal towards you (outward) until the Terminal is detached from the base as show below.



B) Detaching the base cable from the Terminal.

Unplug the base cable from the Terminal.

C) Dismantling the Terminal housing.

Flip the Terminal around. There are 4 screws located underneath the rubber covers at the 4 corners of the bottom housing. Remove these rubber covers and you will be able to locate and remove the 4 hidden screws.




After removing the screws which are securing the bottom housing with the top housing turn the terminal module over. After that carefully lift up the top housing, **DO NOT** remove the top housing completely away from the bottom housing because the Terminal keypad overlay ribbon cable and TFT display ribbon cable are

Alib	oi Memory	Records		
No.	Weight	Tare	Date/Time	Platform
1	1. 10 g	0.00g	01/01/2013 00:01	1
2	50g	34.5g	01/01/2013 00:05	i 1
			· ·	- hei

still attached with the Terminal main PCBA.



STEP 2. Insert the Alibi Memory board into the slot as shown below; making sure the pins and supporting plastic leg are all properly inserted.

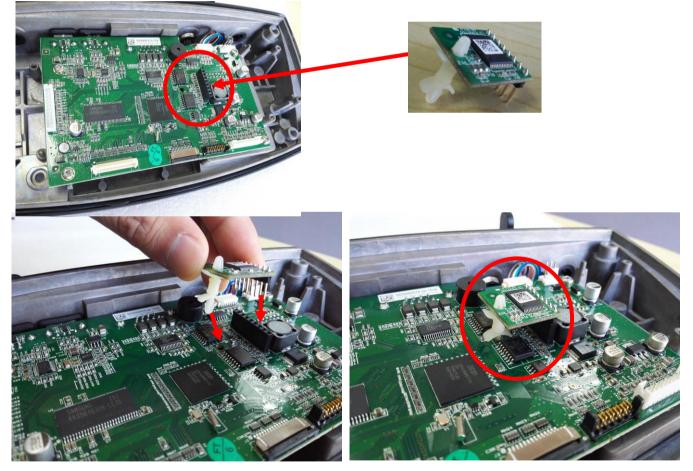

5.12 Maintenance



Note: The import/export is only functional when the current user is administrator.

Maintenance Sub-menu

5.12.1 Export Library Export Library to USB flash drive.



5.12.2 Export User Profile Export User Profile to USB flash drive.



5.12.3 Import' Library Drives Import Library from USB flash drive.



5.12.4 Import User Profile Import User Profile from USB flash drive. **Note:** The existing users will be replaced when importing users.

6. SERIAL COMMUNICATION

6.1 Interface Commands

The scale supports both MT-SICS and OHAUS commands. Commands listed in the following tables will be acknowledged by the scale. To use the MT-SICS commands, send the command PSI. To return to the OHAUS commands, send the command POH.

SICS commands can also be active in the menu setup, please refer to Section 5.9.10 for detail.

OHAUS Commands

Command	Function
IP	Immediate Print of displayed weight (stable or unstable).
Р	Print displayed weight (stable or unstable).
CP	Continuous
SP	Print on Stability.
xS	0S: Turn off "Stable Only" menu item and allow unstable print. 1S: Turn on "Stable Only" menu item and only print stable print.
xP	Interval Print x = Print Interval (1-50000 sec), 0P turns auto print OFF
Z	Same as pressing Zero Key.
Т	Same as pressing Tare Key.
хТ	Download Tare value in grams (positive values only). Sending 0T clears tare (if allowed).
PU	Print current unit: g, kg, lb, oz, lb:oz
хU	Set scale to unit x: 1=kg, 2=lb, 3=g, 4=oz, 5=lb:oz
хM	Set scale to mode x. 1=Weighing, 2=Counting, 3=Check, 4=Formulation, 5=Percent, 6=Filling, 7=Dynamic, 8=Density, 9=Differential. M will scroll to next enabled mode.
PSN	Print Serial Number.
CU xxx	Set Under Limit (only in Check mode) where 'xxx' is the value under current unit
CO xxx	Set Over Limit (only in Check mode) where 'xxx' is the value under current unit
x#	Set Counting APW (x) in grams. (only in Counting or Checkcounting mode, must have APW stored)
P#	Print Counting or Checkcounting mode APW.
x%	Set Percent mode reference weight (x) in grams. (must have reference weight stored)
P%	Print Percent mode reference weight.
PV	Version: print name, software revision and LFT ON (if LFT is set ON).
H x "text"	Enter String content, x = String number (1-10), "text" = string text up to 40 alphanumeric characters.
\EscR	Global reset to reset all menu settings to the original factory defaults.
SNS x	Switch the platform: x = 1, 2

MT-SICS Commands

	Command	Function
LEVEL 0	@	Reset the scale
	10	Inquiry of all available SICS commands
	11	Inquiry of SICS level and SICS versions
	12	Inquiry of scale data
	13	Inquiry of scale software version
	14	Inquiry of serial number
	S	Send stable weight value
	SI	Send weight value immediately
	SIR	Send weight value repeatedly
	Z	Zero the scale
	ZI	Zero immediately
LEVEL 1	D	Write text into display
	DW	Weight display
	SR	Send and repeat stable weight value
	Т	Tare
	ТА	Tare value
	TAC	Clear tare
	TI	Tare immediately

	Command	Function
LEVEL 2	C2	Calibrate with the external calibration weight
	C3	Calibrate with the internal calibration weight
	l10	Inquire or set scale ID
	l11	Inquire of scale type
	P100	Print out on the printer
	P101	Print out stable weight value
	P102	Print out current weight value immediately
	SIRU	Send weight value in the current unit immediately and repeat
	SIU	Send weight value in the current unit immediately
	SNR	Send stable weight value and repeat after every weight change
	SNRU	Send stable weight value in the current unit and repeat after every weight change
	SRU	Send weight value in the current unit and repeat
	ST	After pressing the Transfer key, send the stable weight value
	SU	Send stable weight value in the current unit
LEVEL 3	LST	Send menu settings
	M01	Weighing mode
	M02	Stability setting
	M03	Autozero function
	M19	Send calibration weight
	M21	Inquire/set weight unit
	Р	Print text
	PRN	Print out at every printer interface
	RST	Restart
	SFIR	Send weight value immediately and repeat quickly
	SIH	Send weight value immediately in high resolution
	SWU	Switch weight unit
	SX	Send stable data record
	SXI	Send data record immediately
	SXIR	Send data record immediately and repeat
	U	Switch weight unit

6.2 RS232 Interface

RS232 (DB9) Pin Connections:

- Pin 2: Scale transmit line (TxD)
- Pin 3: Scale receive line (RxD)
- Pin 5: Ground signal (GND)
- Pin 7: Clear to send (hardware handshake) (CTS)
- Pin 8: Request to send (hardware handshake) (RTS)

Use the built-in RS-232 Port to connect either to a computer or a printer.

6.2.1 Connecting to a Computer

Connect to the computer with a standard (straight-through) serial cable.

Use HyperTerminal or a similar terminal software to test communication with the computer.

Set up HyperTerminal as follows:


Choose New Connection, "connect using" COM1 (or available COM port).

Select Baud=9600; Parity=8 None; Stop=1; Handshaking=None. Click OK.

Choose Properties/Settings, then ASCII Setup. Check boxes as illustrated:

(Send line ends...; Echo typed characters...; Wrap lines...)

Verify communication by pressing the Print button. If HyperTerminal is set up properly, the value on the display will be displayed in the window.

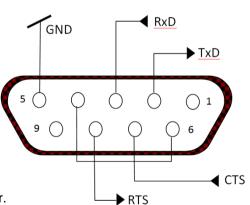


6.2.2 Connecting to a Serial Printer

Connect the cable supplied with the printer to the scale's RS-232 port.

Make sure that the balance and printer communication settings match.

Test communication with the printer by pressing the Print button. If the balance and printer are set up properly, the value on the display will be printed.

The USB Device Interface

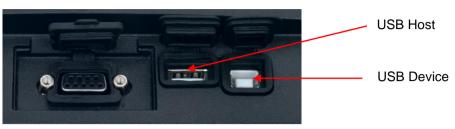

The Ohaus USB Device Interface is a unique solution to the problem of connecting a scale to a computer using a Universal Serial Bus (USB). USB devices are categorized into classes such as disk drives, digital cameras, printers, etc. Scales do not have a commonly used class so the Ohaus USB interface uses a generic interface based on the RS232 serial standard.

Data sent from the scale to a computer is in USB format. The USB data is directed to a *virtual port*. This port then appears as an RS232 port to the application program.

When sending a command from a computer to the scale, the application program sends a command to the *virtual port* as if it were an RS232 port. The computer then directs the command from the *virtual port* to the computers USB connector where the scale is connected. The port receives the USB signal and reacts to the command.

The USB Interface includes a CD with the software drivers to create the required virtual port on the computer.

6.2.3 System Requirements

- PC running Windows 98, Windows 98SE, Windows ME, Windows 2000, Windows XP or Windows 7
- Available USB port (Type A, 4-pin, female)

6.2.4 USB Connection

The scale's USB Device port terminates with a 4-pin, female, USB Type B connector.

A USB Cable (type B/male to type A/male) is required (not supplied).

- 1. Ensure that the scale is powered on and working properly.
- 2. Power on the computer and verify that its USB port is enabled and working properly.
- 3. Plug the cable's USB connectors into the computer's USB port and the scale's USB port. Windows should detect a USB device and the New Hardware Wizard will be initialized.

6.2.5 Virtual Port Software Installation

- 1. Insert the supplied CD into the computer's CD drive. Different versions of Windows have slightly different steps to load the driver that is on the CD. In all versions the New Hardware Wizard guides you through the required steps to select the driver that is located on the CD.
- 2. After clicking Finish, the virtual port should be ready for use.

Windows typically adds the virtual port in sequence after the highest number COM port. For example, on PC's equipped with up to 4 COM ports, the virtual port will be COM5.

When using the USB interface with programs that limit the number of COM port designations (e.g. Ohaus MassTracker allows only COM1, 2, 3, & 4), it may be necessary to assign one of these port numbers to the new virtual port.



Example of Windows XP Hardware Wizard

This can be done in the Port Settings of the Device Manager utility, found in the Windows Control Panel.

6.3 USB Host

The USB Host can be used to connect a barcode scanner and USB flash drive to the Ranger 7000.

6.4 Printout Format

Printout string for g, kg, lb, oz units: Check Weighing application:

Field	Weight	Space	Unit	Space	Stability	Space	T/N/G/PT	Space	Application	Term.
	(Right	-	(Right		(?)		(Right		Status	
	aligned)		aligned)				aligned)		(Right aligned)	
Length	11	1	5	1	1	1	2	1	6	2

Non-Check Weighing application:

 <u></u>								
Field	Weight	Space	Unit	Space	Stability	Space	T/N/G/PT	Term.
	(Right	-	(Right	-	(?)	-	(Right	
	aligned)		aligned)				aligned)	
Length	11	1	5	1	1	1	2	2

Each field is followed by a single delimiting space (ASCII: 32).

Definitions:

Weight - Up to 11 characters, right justified, - at immediate left of most significant character (if negative).

Unit - Up to 5 characters, right justified. If the Unit in the Print Content menu was set to OFF, the unit will be removed in the weight string and replaced by spaces.

Stability - "?" character is printed if not stable. If weight is a space is printed.

T/N/G/PT - "T" is printed for a tare weight, "N" printed if weight is net weight, 'G' or nothing printed if weight is a gross weight, 'PT' is printed if the tare weight is Pre-set Tare.

Application Status (for Check) – Fixed to 6 characters. Display status like " Under", "Accept" and "Over" for check weighing.

Terminating Character(s) - terminating character(s) printed depending on FEED menu setting.

Printout string for the lb:oz unit

1 11110	acounig													
Field	Weight1	Space	Unit1	Space	Weight2	Space	Unit2	Space	Stability	Space	G/N	Space	Message	Term.Char(s)
Length	4	1	2	1	7	1	2	1	1	1	1	1	5	2

- The printout string has a fixed length of 28 characters.
- Each Space field is a delimiting space used to separate the other fields.
- The Weight1 field is 4 right justified characters. If the value is negative, the '-' character is located at the immediate left of the most significant digit.
- The Unit1 field is 2 left justified characters.
- The Weight2 field is 7 right justified characters.
- The Unit2 field is 2 left justified characters.
- The Stability field is 1 character. A space is printed if the weight value is stable. A '?' is printed if the weight value is not stable.
- The G/N field is 1 character. 'G' is printed for a gross weight. 'N' is printed for a net weight.
- The Message field is 5 left justified characters.

Note: The Termination Characters Carriage Return and Line Feed are appended to the printout.

6.5 Printout Examples

Setup in Menu	Print out
{String 1} {New Line}	OHAUS CORPORATION
{String 2} {New Line}	7 Campus Drive
{String 3} {New Line}	Suite 310
{New Line}	
{Time} {3 spaces} {3 spaces} {Date} {New Line}	10:01 04/22/2016
{ID} {New Line}	50
{Result} {New Line}	500.0 g
{New Line}	
{String 4} {New Line}	Signature
{String 5} {New Line}	Verified by
{End of template}	

<pre>(String 9) (New Line) (String 10) (New Line) (String 12) (New Line) (String 12) (New Line) (String 12) (New Line) (String 13) (New Line) (String 16) (Project ID) (New Line) (String 17) (Scale ID) (New Line) (String 18) (Mode) (New Line) (String 18) (Mode) (New Line) (String 18) (Mode) (New Line) (String 18) (Now Line) (String 19) (New Line) (String 19) String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Near ID: String 16: Project ID: String 17: Scale ID: String 18: Mode: String 12: String 18: Mode: String 12: Zot Verified by:</pre>	Setup in Menu	Sample of Sieve Print out
String 19 (New Line) OHAUS Corporation (String 11) (New Line) (String 13) (New Line) (String 13) (New Line) (String 13) (New Line) (String 15) (New Line) (String 15) (New Line) (String 15) (New Line) (String 15) (New Line) (String 15) (New Line) (String 15) (New Line) (String 17) (Scale ID) (New Line) (String 13) (Mode) (New Line) (String 19) (New Line) (String 19) (New Line) (String 20) (New Line) (String 19) (New Line) (String 20) (New Line) (String 12) (New Line) (String 20) (New Line) (String 20) (New Line) (End of template) Sample ID: 1234567890 DATA String 10: OHAUS Corporation String 10: OHAUS Corporation Size Measured Weight * som 112.6 g Pan 39.3 g * used in FM calculation Weight Lost 1. 06% String 10: OHAUS Corporation Size Acc. % retained String 12: Parsipany NU 07054 Size Acc. % retained String 12: Parsipany NU 07054 Size Acc. Wt. retained String 12: Parsipany NU 07054 Size Acc. Wt. retained String 12: Parsipany NU 07054 Size Acc. Wt. retained String 12: Node:		
<pre>(String 11) (New Line) (String 12) (New Line) (String 13) (New Line) (String 15)(User ID) (New Line) (String 15)(User ID) (New Line) (String 15)(Scale ID) (New Line) (String 15)(Scale ID) (New Line) (String 16)(Mode) (New Line) (String 19) (New Line) (Result)(New Line) (String 19) (New Line) (String 10) (New Line) (String 10) OHAUS Corporation String 10: OHAUS Corporation String 12: Parsippany NJ 07054 String 12: Parsippany NJ 07054 String 13: www.ohaus.com 1.800.672.7722 String 14: Wode: String 16: Project ID: String 17: Campus Drive Ste 310 String 16: Project ID: String 17: Node: String 17: Node: String 18: Wode: String 19: Weifed by:</pre>		OHAUS Corporation
<pre>(String 12) (New Line) (String 13) (New Line) (String 15) (Lser ID) (New Line) (String 17) (Scale ID) (New Line) (String 18) (Mode) (New Line) (String 18) (Mode) (New Line) (New Line) (New Line) (Result] (New Line) (String 19) (New Line) (String 10) (New Line) (String 112) Parsippany NJ 07054 String 12: New Line) String 16: Project ID: String 17: Scale ID: String 18: Mode: String 19: Signature: String 19: Sign</pre>		
<pre>(String 13) (New Line) (New Line) (String 15)(User ID) (New Line) (String 15)(Scale ID) (New Line) (String 16)(Project ID) (New Line) (String 17)(Scale ID) (New Line) (String 19) (New Line) (String 10) CHAUS Corporation String 10: OHAUS Corporation String 10: OHAUS Corporation String 11: User ID: String 15: User ID: String 16: Project ID: String 17: Cale ID: String 18: Mode: String 19: Over ID: String 19: Now Chaus.com 1.800.672.7722 String 20: Verified by:</pre>		
New Line) (String 15)(User ID) (New Line) (String 15)(Type (Cl ID) (New Line) (String 17)(Scale ID) (New Line) (String 18)(Mode) (New Line) (String 18)(Mode) (New Line) (String 18)(Mode) (New Line) (String 18)(Mode) (New Line) (String 19) (New Line) (String 19) (New Line) (String 19) (New Line) (String 20) (New Line) (String 20) (New Line) (String 20) (New Line) (String 19) (New Line) (String 20) (New Line) (String 19) (New Line) (String 20) (New Line) (String 10) (New Line) (String 10) (New Line) </td <td></td> <td></td>		
<pre>(String 16)(Project ID: (New Line) (String 17)(Scale ID) (New Line) (Date) (3 spaces) { Time } (New Line) (String 18)(Mode) (New Line) (Result)(New Line) (Result)(New Line) (Result)(New Line) (String 19) (New Line) (String 19) (New Line) (End of template)</pre> Sample ID: 1234567890 DATA Start Weight: 511.0 g Size Measured Weight * 5cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5cm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% String 10: OHAUS Corporation String 10: OHAUS Corporation String 10: OHAUS Corporation String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Parsippany NJ 07054 String 15: User ID: String 16: Project ID: String 16: Project ID: String 17: Scale ID: String 18: Mode: String 20: Verified by:		
<pre>(String 17)(Scale ID) (New Line) (Data) (3 spaces) (Time) (New Line) (String 18)(Mode) (New Line) (Result)(New Line) (Result)(New Line) (String 19) (New Line) (End of template)</pre> Sample ID: 1234567890 DATA Start Weight: 511.0 g Size Measured Weight * 5cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost: 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% Size Acc. % retained Scm 69.96% 30.04% 20mm 922.23% Pan 100.00% Size Acc. Wt. retained Scm 69.96% Size Acc. Wt. retained Scm 69.96% Size Acc. Wt. retained Scm 353.7 g 20mm 466.3 g Pan 505.6 g		User ID:OHAUS
[Date] (3 spaces) (Time] (New Line) (String 18)(Mode) (New Line) (New Line) (Result)(New Line) (Result)(New Line) (String 19) (New Line) (String 19) (New Line) (String 20) (New Line) (End of template) 93/31/2017 14:03 Mode:Sieve Sample ID: 1234567890 (New Line) (String 20) (New Line) (End of template) DATA Start Weight: 511.0 g Size Measured Weight * 5cm * 20mm 112.6 g Pan * used in FM calculation Weight Lost: 5.4 g Weight Lost: * used in FM calculation Weight Lost: 5.4 g Weight Lost: String 9: MALYSIS String 9: Size Acc. % retained Scm String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 11: 7 Campus Drive Ste 310 String 13: www.ohaus.com 1.800.672.7722 String 15: User ID: String 15: User ID: String 17: Scale ID: String 17: Scale ID: String 18: Mode: Size Acc. Wt. retained Scm String 19: Signature: Size Acc. Wt. retained Scm Size Acc. Wt. retained Scm String 10: Signature: Pan 505.6 g String 10: Signature: Pan 505.6 g String 10: Signature: Pan 505.6 g		Project ID:Troy Hills Mall Parking Lot
<pre>(String 18/Mode) {New Line} (New Line) {Result; New Line} (String 20) {New Line} (String 20) {New Line} (End of template)</pre> Sample ID: 1234567890 DATA Start Weight: 511.0 g Size Measured Weight * 5cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5cm 69.96% 30.04% 20mm 92.27% 7.77% Pan 7.77% 0.00% String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Parsipapary NU 07054 String 13: www.ohaus.com 1.800.672.7722 String 15: User ID: String 17: Scale ID: String 10: Verified by:		Scale ID:Ranger 28544655383
<pre>{New Line} {Result/(New Line) {Result/(New Line) {String 19] (New Line) {End of template}</pre> Size Measured Weight * 5cm 353.7 g * Used in FM calculation Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5cm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% String 11: 7 Campus Drive Ste 310 String 12: Parsipaph N 07054 String 12: Parsipaph N 07054 String 13: www.ohaus.com 1.800.672.7722 String 13: www.ohaus.com 1.800.672.7722 String 13: Signature: String 10: Signature: String 10: Signature: String 10: Signature: String 11: Signature: String 11: Signature: String 12: Signature: String 13: Signature: String 14: Signature: String 15: Signature: String 14: Signature: String 15: Signature: String 14: Signature: String 15: Signature: String 15: Signature: String 15: Signature: String 12: Signature: String 12: Signature: String 12: Signature: String 13: Signature: String 14: Signature: String 14: Signature: String 15: Signature: String 14: Signature: String 15: Signature: String 14: Signature: String 15: Signature: String 14: Signature: String 14: Signature: String 14: Signature: String 14: Signature: String 14: Signature: String 1		
{Result}(New Line) Sample ID: 1234567890 {New Line} String 19 {New Line} {String 19 {New Line} Start Weight: 511.0 g {End of template} Size Measured Weight * 5cm 353.7 g 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost: 5.4 g Weight: 505.6 g ANALYSIS Size Retained Passed String 9:		Mode:Sieve
<pre>{New Line} {String 19} {New Line} {String 19} {New Line} {End of template} </pre> DATA Start Weight: 511.0 g Lat Weight: 511.0 g Size Measured Weight * 5 Cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5 Cm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Parsipapany NJ 07054 String 13: www.ohaus.com 1.800.672.7722 String 13: www.ohaus.com 1.800.672.7722 String 15: User ID: String 19: Project ID: String 19: Signature: String 19: Signature: String 19: Signature: String 20: Verified by: String 20: Verified by:		
<pre>(String 19) {New Line} (String 20) {New Line} (End of template)</pre> DATA Start Weight: 511.0 g Size Measured Weight * 5cm 353.7 g Pan 39.3 g Pan 106% End Weight Lost: 5.4 g Weight Lost: 7.7% End Weight: 505.6 g ANALYSIS Size Retained Passed Scm 69.96% 20mm 22.27% 7.77% Pan 7.77% 0.00% Size Acc. % retained Scm 69.96% 20mm 92.23% Pan 100.00% Size Acc. wt. retained Scm 353.7 g 20mm 466.3 g Pan 505.6 g Fineness Modulus: 1.62 Signature:		Sample ID: 1234567890
<pre>{String 20) {New Line} {End of template}</pre> Start Weight: 511.0 g Size Measured Weight * 5cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5cm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% Siring 10: OHAUS Corporation String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Parsippany NJ 07054 String 13: www.ohaus.com 1.800.672.7722 String 16: User ID: String 16: Project ID: String 16: Project ID: String 16: Project ID: String 18: Mode: String 19: Signature: String 20: Verified by:		
{End of template} Size Measured Weight * 5cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost: 5.4 g Weight Lost: 5.6 g ANALYSIS Size Retained Passed 5cm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% String 10: OHAUS Corporation Size Acc. % retained String 11: 7 Campus Drive Ste 310 Size Acc. % retained String 12: Parsippany NJ 07054 Size Acc. Wt. retained String 15: User ID: Size Acc. Wt. retained String 16: Project ID: Size Acc. Wt. retained String 19: Signature: Som String 19: Signature: Som String 20: Verified by: Fineness Modulus: 1.62		
SizeMeasured Weight* 5cm353.7 g* 20mm112.6 gPan39.3 g* used in FM calculationWeight Lost:5.4 gWeight Lost:5.4 gWeight Lost:5.6 gANALYSISString 9:SizeString 10:OHAUS CorporationString 11:7 Campus Drive Ste 310String 12:Parsippany NJ 07054String 15:User ID:String 16:PointString 17:Scale ID:String 18:Mode:String 19:Signature:String 19:Signature:String 20:Verified by:Fineness Modulus:1.62Signature:Signature:		Start Weight: 511.0 g
<pre>* 5cm 353.7 g * 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5cm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00% String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Parsippany NJ 07054 String 13: www.ohaus.com 1.800.672.7722 String 15: User ID: String 16: Project ID: String 15: User ID: String 19: Signature: String 19: Signature: String 20: Verified by:</pre>		Size Measured Woight
* 20mm 112.6 g Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight: 505.6 g ANALYSIS Size Retained Passed String 10: OHAUS Corporation Size Acc. % retained String 11: 7 Campus Drive Ste 310 Size Acc. % retained String 12: Parsippany NU 07054 20mm 92.23% Pan 100.00% String 13: www.ohaus.com 1.800.672.7722 Size Acc. Wt. retained String 15: User ID: Size Acc. Wt. retained String 19: Signature: 20mm 466.3 g Pan 505.6 g Fineness Modulus: 1.62		
Pan 39.3 g * used in FM calculation Weight Lost: 5.4 g Weight Lost: 5.4 g Weight Lost: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed String 9: 69.96% String 10: OHAUS Corporation Size Acc. % retained String 11: 7 Campus Drive Ste 310 Size Acc. % retained String 12: Parsippany NJ 07054 20mm 92.23% String 13: www.ohaus.com 1.800.672.7722 Size Acc. Wt. retained 5cm String 16: Project ID: Size Acc. Wt. retained 5cm String 18: Mode: 20mm 466.3 g String 19: Signature: Pan 505.6 g String 19: Signature: Pan 505.6 g String 20: Verified by: Fineness Modulus: 1.62 Signature:		* 20mm 112.6 g
* used in FM calculation * used in FM calculation Weight Lost: 5.4 g Weight Lost %: 1.06% End Weight: 505.6 g ANALYSIS Size Retained Passed 5cm 69.96% 20mm 22.27% 7.77% Pan 7.77% 0.00% String 10: OHAUS Corporation String 12: Parsippany NU 07054 String 13: www.ohaus.com 1.800.672.7722 String 15: User ID: String 16: Project ID: String 17: Scale ID: String 18: Mode: String 19: Signature: Pan 505.6 g String 19: Signature: Pan 505.6 g		Pan 39.3 g
Weight Lost:5.4 g Weight Lost %:I.06% End Weight:505.6 gANALYSIS Size Retained Passed Scm 69.96% 30.04% 20mm 22.27% 7.77% Pan 7.77% 0.00%String 10: OHAUS Corporation String 11: 7 Campus Drive Ste 310 String 12: Parsippany NJ 07054 String 13: www.ohaus.com 1.800.672.7722 String 16: Project ID: String 17: Scale ID: String 18: Mode: String 19: Signature:String 20: Verified by:Signature: Fineness Modulus: 1.62Signature: String 20: Verified by:Signature: Signature: Signature:		
End Weight:505.6 gANALYSISSizeRetainedString 9:30.04%20mm22.27%7.77%PanPan7.77%Pan7.77%Pan7.77%Pan7.77%Pan7.77%Pan7.77%Pan9.96%String 10:OHAUS CorporationString 11:7 Campus Drive Ste 310String 12:Parsippany NJ 07054String 12:Parsippany NJ 07054String 13:www.ohaus.com 1.800.672.7722String 16:Project ID:String 17:Scale ID:String 18:Mode:String 19:Signature:String 20:Verified by:Pan505.6 gFineness Modulus:1.62Signature:		* used in FM calculation
End Weight:505.6 gANALYSISSizeRetainedString 9:30.04%20mm22.27%7.77%PanPan7.77%Pan7.77%Pan7.77%Pan7.77%Pan7.77%Pan7.77%Pan9.96%String 10:OHAUS CorporationString 11:7 Campus Drive Ste 310String 12:Parsippany NJ 07054String 12:Parsippany NJ 07054String 13:www.ohaus.com 1.800.672.7722String 16:Project ID:String 17:Scale ID:String 18:Mode:String 19:Signature:String 20:Verified by:Pan505.6 gFineness Modulus:1.62Signature:		Weight Lost: 5.4 g
End Weight:505.6 gANALYSISSizeRetainedString 9:30.04%20mm22.27%7.77%PanPan7.77%Pan7.77%Pan7.77%Pan7.77%Pan7.77%Pan7.77%Pan9.96%String 10:OHAUS CorporationString 11:7 Campus Drive Ste 310String 12:Parsippany NJ 07054String 12:Parsippany NJ 07054String 13:www.ohaus.com 1.800.672.7722String 16:Project ID:String 17:Scale ID:String 18:Mode:String 19:Signature:String 20:Verified by:Pan505.6 gFineness Modulus:1.62Signature:		Weight Lost %: 1.06%
SizeRetainedPassed5cm69.96%30.04%20mm22.27%7.77%Pan7.77%0.00%String 10: OHAUS CorporationSizeAcc. % retainedString 11: 7 Campus Drive Ste 3105cm69.96%String 12: Parsippany NJ 0705420mm92.23%String 13: www.ohaus.com 1.800.672.7722Pan100.00%String 15: User ID:SizeAcc. Wt. retainedString 16: Project ID:SizeAcc. Wt. retainedString 17: Scale ID:SizeAcc. Wt. retainedString 19: Signature:20mm466.3 gString 20: Verified by:Pan505.6 gFineness Modulus: 1.62Signature:		End Weight: 505.6 g
SizeRetainedPassed5cm69.96%30.04%20mm22.27%7.77%Pan7.77%0.00%String 10: OHAUS CorporationSizeAcc. % retainedString 11: 7 Campus Drive Ste 3105cm69.96%String 12: Parsippany NJ 0705420mm92.23%String 13: www.ohaus.com 1.800.672.7722Pan100.00%String 15: User ID:SizeAcc. Wt. retainedString 16: Project ID:SizeAcc. Wt. retainedString 17: Scale ID:SizeAcc. Wt. retainedString 19: Signature:20mm466.3 gString 20: Verified by:Pan505.6 gFineness Modulus: 1.62Signature:		
String 9: ***********************************		ANALYSIS
20mm22.27%7.77%Pan7.77%0.00%String 9:*********************************		
String 9:Pan7.77%0.00%String 10:OHAUS CorporationSizeAcc. % retainedString 11:7 Campus Drive Ste 3105cm69.96%String 12:Parsippany NJ 0705420mm92.23%String 13:www.ohaus.com 1.800.672.7722Pan100.00%String 15:User ID:SizeAcc. Wt. retainedString 16:Project ID:SizeAcc. Wt. retainedString 17:Scale ID:SizeAcc. Wt. retainedString 18:Mode:20mm466.3 gString 20:Verified by:Pan505.6 gString 20:Verified by:FinenessModulus: 1.62		5cm 69.96% 30.04%
String 9:SizeAcc. % retainedString 10:OHAUS CorporationSizeAcc. % retainedString 11:7 Campus Drive Ste 3105 cm69.96%String 12:Parsippany NJ 0705420mm92.23%String 13:www.ohaus.com 1.800.672.7722Pan100.00%String 15:User ID:SizeAcc. Wt. retainedString 16:Project ID:SizeAcc. Wt. retainedString 17:Scale ID:SizeAcc. Wt. retainedString 18:Mode:20mm466.3 gString 20:Verified by:Pan505.6 gString 20:Verified by:Fineness Modulus: 1.62		20mm 22.27% 7.77%
String 10: OHAUS CorporationSizeAcc. % retainedString 11: 7 Campus Drive Ste 3105cm69.96%String 12: Parsippany NJ 0705420mm92.23%String 13: www.ohaus.com 1.800.672.7722Pan100.00%String 15: User ID:SizeAcc. Wt. retainedString 16: Project ID:SizeAcc. Wt. retainedString 17: Scale ID:SizeAcc. Wt. retainedString 18: Mode:20mm466.3 gString 19: Signature:Pan505.6 gString 20: Verified by:Fineness Modulus: 1.62Signature:Signature:		Pan 7.77% 0.00%
String 10: Of Acts Coliporation5cm69.96%String 11: 7 Campus Drive Ste 31020mm92.23%String 12: Parsippany NJ 0705420mm92.23%String 13: www.ohaus.com 1.800.672.7722Pan100.00%String 15: User ID:SizeAcc. Wt. retainedString 16: Project ID:SizeAcc. Wt. retainedString 17: Scale ID:SizeAcc. Wt. retainedString 18: Mode:20mm466.3 gString 19: Signature:Pan505.6 gString 20: Verified by:Fineness Modulus: 1.62Signature:Signature:		Size Acc % retained
String 11: 7 Campus Drive Ste 310String 12: Parsippany NJ 07054String 13: www.ohaus.com 1.800.672.7722String 15: User ID:String 16: Project ID:String 17: Scale ID:String 18: Mode:String 19: Signature:String 20: Verified by:String 20: Verified by:String 20: Verified by:		
String 12: Paisippany No 07004Pan100.00%String 13: www.ohaus.com 1.800.672.7722Size Acc. Wt. retainedString 15: User ID:Size Acc. Wt. retainedString 16: Project ID:ScmString 17: Scale ID:ScmString 18: Mode:20mmString 19: Signature:PanString 20: Verified by:Fineness Modulus: 1.62Signature:Signature:		
String 15: User ID:String 16: Project ID:String 17: Scale ID:String 18: Mode:String 19: Signature:String 20: Verified by:String 20: Verified by:		
String 16: Project ID:SizeAcc. Wt. retainedString 17: Scale ID:5cm353.7 gString 18: Mode:20mm466.3 gString 19: Signature:Pan505.6 gString 20: Verified by:Fineness Modulus: 1.62Signature:Signature:		
String 17: Scale ID: 5cm 353.7 g String 18: Mode: 20mm 466.3 g String 19: Signature: Pan 505.6 g String 20: Verified by: Fineness Modulus: 1.62 Signature: Signature:		Size Acc. Wt. retained
String 18: Mode: 20mm 466.3 g String 19: Signature: Pan 505.6 g String 20: Verified by: Fineness Modulus: 1.62 Signature: Signature:		
String 19: Signature: Pan 505.6 g String 20: Verified by: Fineness Modulus: 1.62 Signature: Signature:		
String 20: Verified by: Fineness Modulus: 1.62 Signature:		Pan 505.6 g
Signature:		
Signature:		Fineness Modulus: 1.62
315-Bildedi et		Signature:
Verified by:		Verified by:

7. LEGAL FOR TRADE

When the scale is used in trade or a legally controlled application it must be set up, verified and sealed in accordance with local weights and measures regulations. It is the responsibility of the purchaser to ensure that all pertinent legal requirements are met.

7.1 Settings

Before verification and sealing, perform the following steps in order:

- 1. Verify that the menu settings meet the local weights and measures regulations.
- 2. Units menu should be reviewed. Verify the units turned on meet the local weights and measures regulations.
- 3. Perform a calibration as explained in Section 5.
- 4. Set the position of the Security Switch to the locked position.

RANGER[®] 7000 SCALES

7.2 Verification

A weights and measures official or authorized service agent must perform the verification procedure.

7.3 Sealing

After the scale has been verified, it must be sealed to prevent undetected access to the legally controlled settings. Before sealing the device, ensure that the security switch is in the Locked position.

If using a wire seal, pass the sealing wire through the holes in the security screw and tab, as shown.

If using a paper seal, place the seal over the flat head screw as shown

A. Base







Un-Locked

Locked with Wire Seal



B. Terminal



Un-locked

Locked with Wire Seal

Locked with Paper Seal

Note: The Terminal only needs to be sealed if a second scale is attached to the optional 2nd A/D board.

8. MAINTENANCE

Calibration 8.1

Periodically verify calibration by placing an accurate weight on the scale and viewing the result. If calibration is required, perform as explained in section 5.

8.2 Information

(i) Information is available from any application and is accessed by pressing the button.

The following data is available for the Application used:

Application	Statistics	Accumulation	General Status	Help	Icons Explanation
Weighing	х	x	х	х	х
Counting		x	х	х	x
Percent		х	х	х	х
Check		х	х	х	х
Dynamic		x	х	х	х
Filling		х	х	х	х
Formulation			х	х	х
Differential			х	х	х
Density			х	х	x
Sieve			х	х	x

Press the (i) button to enter the **Information** area.

Use the buttons corresponding to the icons

to toggle through the various Information screens.

Note: To return to Application Home screen from the Information area, press the i button.

Accumulate F	Result
Number of Samples : 0	
Total : 0.0 g Average : 0.0 g	
Minimum : 0.0 g	
Maximum : 0.0 g	
Range : 0.0 g	

To clear data, use the buttons corresponding to the icons

and **A** to select the item to be cleared,

then press the **CLR** button.

A warning message appears, press the button

corresponding to the **event** icon to confirm the deletion.

To abort the deletion press the button corresponding to the icon

Warning	
Clear the Accumulate Data?	
	×

8.3 Cleaning

 $\overline{}$



Disconnect the Ranger 7000 Scale from the power supply before cleaning. Make sure that no liquid enters the interior of the Terminal or Base.

Clean the Scale at regular intervals.

Housing surfaces may be cleaned with a lint-free cloth slightly dampened with water or a mild cleaning agent.

Attention: Do not use solvents, harsh chemicals, ammonia or abrasive cleaning agents.

8.4 Troubleshooting

	TADLE 0-1. TROUDL	
Error Code	Description	Cause
EEP Error	EEPROM Checksum Error	Corrupted EEPROM data
Power on	Power On Error	Weight reading exceeds Power
Overload		On Zero limit.
Power on	Power On Error	Weight reading below Power On
Underload		Zero limit.
Overload	Over Range Error	Weight reading exceeds Overload limit.
Underload	Under Range Error	Weight reading below Underload
		limit.
Tare Error	Tare out of range Error	Tared at one unit but after
		switching to another unit the tare
		value exceeds the maximum.
Display	Display Overflow	Weight exceeds 6 digits.
Overflow		
No	Calibration data error	Calibration data does not exist.
Calibration		
	Busy message	Displayed during tare setting, zero setting, printing
NO	Action not allowed	Function not executed.
	message	
Calibration	Calibration Error	Calibration value outside
Error		allowable limits
Low	Low reference weight	Average Piece Weight too small.
Reference	warning message	(Warning)
Reference	Unacceptable reference	Reference Weight too small. The
Error	weight message	weight on the pan is too small to
		define a valid reference weight.

TABLE 8-1. TROUBLESHOOTING

8.5 Service Information

If the troubleshooting section does not resolve your problem, contact an Authorized Ohaus Service Agent. Please visit our website **www.ohaus.com** to locate the Ohaus office nearest you. An Ohaus Product Service Specialist will be available to assist you.

8.6 Software Updates

Ohaus is continuously improving its scale software. To obtain the latest release, please contact your Authorized Ohaus Dealer or Ohaus Corporation.

9. TECHNICAL DATA

9.1 Specifications

Ambient conditions

- Indoor use only
- Altitude: Up to 2000 m
- Specified Temperature range: 10 °C to 30 °C (R71MHD3/6/15/35 models) -10 °C to 40 °C (R71MD3/6/15/35 models)
- Humidity: maximum relative humidity 80 % for temperatures up to 30 °C decreasing linearly to 50 % relative humidity at 40 °C
- Mains supply voltage fluctuations: up to ±10 % of the nominal voltage
- Installation category II
- Pollution degree: 2
- Operability is assured at ambient temperatures between 5 °C to 40 °C.

Materials

- Base Housing; die-cast Aluminum, Painted
- Terminal housing: die-cast Aluminum, Painted
- Weighing Pan: 304 Stainless Steel

TABLE 9-1. SPECIFICATIONS


MODEL	R71MHD3	R71MHD6	R71MHD15	R71MHD35		
Capacity	3000 g	6000 g	15000 g	35000 g		
Readability d	0.01 g	0.02 g	0.1 g	0.1 g		
Approved Readability e	0.1 g	0.2 g	1 g	1 g		
Repeatability (std. dev.)	± 2 d	± 2 d	± 2 d	± 2 d		
Linearity	± 2 d	± 2 d	± 2 d	± 2 d		
Weighing units	gram, k	ilogram, ounce, poun	d, pound:ounce, cus	tom unit		
Applications		s Counting, Percent V ling, Formulation, Dif				
Stabilization time (typical)		Within 1	second			
Safe overload protection		150 % of	Capacity			
Display	TFT Graphic LCD					
Display size		4.3	inch			
Backlight		White	e LED			
Communication		RS-232	2, USB			
Power supply		Power Input: 100-24	0 V~ 0.5 A 50/60 Hz			
Approval class		l	I			
Platform size	210 x 2 8.3 x 8	10 mm .3 inch	377 x 311 mm 14.8 x 12.2 inch			
Terminal Housing dimensions (W x D x H)	267 x 118 x 72 mm 10.5 x 4.6 x 2.8 inch					
Base Housing dimensions (W x D x H)			377 x 311 14.9 x 12.	x 128 mm 2 x 5 inch		
Assembled dimensions (W x D x H)			x 128 mm 4 x 5 inch			
Net weight	7.2 kg / 16 lb		10.9 kg / 24 lb			
Shipping weight	9.2 kg / 20.3 lb		14.4 kg / 31.7 lb			
Shipping dimension	605 x 405 23.8 x 15.9			x 330 mm 7 x 13 inch		

MODEL	R71MD3 R71MD6		R71MD15	R71MD35	R71MD60		
Capacity	3000 g	6000 g	15000 g	35000 g	60000 g		
Readability d	0.05 g	0.1 g	0.2 g	0.5 g	1 g		
Approved Readability e	0.5 g	1 g	2 g	5 g	10 g		
Repeatability (std. dev.)	± 2 d	± 2 d	± 2 d	± 2 d	± 2 d		
Linearity	± 2 d	± 2 d	± 2 d	± 2 d	± 2 d		
Weighing units	gram	n, kilogram, ounc	e, pound, pound	d:ounce, custom	unit		
Applications		arts Counting, Pe Filling, Formulat					
Stabilization time (typical)		1	Within 1 second				
Safe overload capacity		15	50 % of Capacit	у			
Display	TFT Graphic LCD						
Display size	4.3 inch						
Backlight	White LED						
Communication	RS-232, USB						
Power supply		Power Input:	100-240 V~ 0.5	A 50/60 Hz			
Approval class							
Platform size	280 x 280 mm 377 x 311 mm 11 x 11 inch 14.8 x 12.2 inch						
Terminal Housing dimensions (W x D x H)	267 x 118 x 72 mm 10.5 x 4.6 x 2.8 inch						
Base Housing dimensions (W x D x H)	280 x 280 x 114 mm 377 x 311 x 128 mm 11 x 11 x 4.5 inch 14.9 x 12.2 x 5 inch						
Assembled dimensions (W x D x H)	280 x 420 x 114 mm 377 x 467 x 128 mm 11 x 16.5 x 4.5 inch 14.9 x 18.4 x 5 inch						
Net weight	6.8 kg / 15 lb		9.9 kg / 21.8 lb				
Shipping weight	8.5 kg /	/ 18.7 lb	13.4 kg / 29.5 lb				
Shipping dimensions		x 244 mm 9 x 9.6 inch	665 x 525 x 330 mm 26.2 x 20.7 x 13 inch				

9.2 Drawings and Dimensions


Fully assembled dimensions



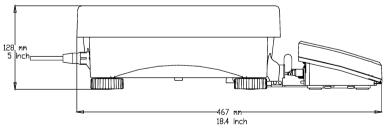

377 mm 14.9 inch

B. Small Base

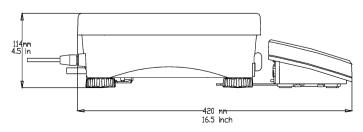

 


Figure 9-1. Ranger 7000 dimensions

9.3 Table of Geo Values

For weighing instruments verified by the manufacturer, the geo value indicates the country or geographical zone for which the instrument is verified. The Geo value set in the instrument (e.g. "Geo 18") appears briefly after switch-on or is specified on a label.

Note: GEO values are only applicable for models R71MD3, R71MD6, R71MD15 and R71MD35

	TABLE 9-3. GEO CODES Elevation in meters											
		•	205	650	075				0075	0000	2025	2050
		0	325	650	975	1300	1625	1950	2275	2600	2925	3250
		325	650	975	1300	1625	1950	2275	2600	2925	3250	3575
			4000	0400	0000		vation in		7400	0500	0000	40000
		0	1060	2130	3200	4260	5330	6400	7460	8530	9600	10660
1	(1060	2130	3200	4260	5330	6400	7460	8530	9600	10660	11730
	tude	_					GEO valu					
0°00'	5°46'	5	4	4	3	3	2	2	1	1	0	0
5°46'	9°52'	5	5	4	4	3	3	2	2	1	1	0
9°52'	12°44'	6	5	5	4	4	3	3	2	2	1	1
12°44'	15°06'	6	6	5	5	4	4	3	3	2	2	1
15°06'	17°10'	7	6	6	5	5	4	4	3	3	2	2
17°10'	19°02'	7	7	6	6	5	5	4	4	3	3	2
19°02' 20°45'	20°45'	8	7	7	6 7	6	5	5	4	4	3	3
20 45 22°22'	22°22'	8	8			6	6	5	5	4		3
	23°54'	9	8	8	7	7	6	6	5	5	4	4
23°54' 25°21'	25°21'	9 10	9	8 9	8 8	7	7	6 7	6	5 6	5 5	4 5
25°21° 26°45'	26°45' 28°06'	-	9			8			6			
	28°06' 29°25'	10	10	9	9	8	8	7 °	7	6	6	5
28°06'		11	10	10	9	9	8	8	7	7	6	6
29°25' 30°41'	30°41' 31°56'	11 12	11 11	10 11	10	9 10	9 9	8	8	7	7	6 7
30°41' 31°56'	31°56' 33°09'	12 12	11 12	11 11	10 11	10	9 10	9 9	8	8	7	
			12	11					9	8	8	7 0
33°09' 34°21'	34°21' 35°31'	13 13		12	11 12	11 11	10 11	10	9 10	9 9	8 9	8
			13 13			12		10 11				
35°31' 36°41'	36°41'	14 14	13	13	12		11 12	11	10	10	9	9
	37°50'			13	13	12			11	10	10	-
37°50'	38°58'	15 15	14 15	14 14	13 14	13 13	12 13	12 12	11 12	11 11	10 11	10
38°58'	40°05'											10
40°05' 41°12'	41°12' 42°19'	16 16	15 16	15 15	14 15	14 14	13 14	13 13	12 13	12 12	11 12	11 11
41 12 42°19'	42 19 43°26'	10	16	15	15	14	14	13	13	12	12	12
42 19 43°26'	43 20 44°32'	17	10	16	16	15	14	14	13	13	12	12
43 20 44°32'	44 32 45°38'	17	17	10	16	16	15	14	14	14	13	12
44 32 45°38'	45 36 46°45'	18	17	17	10	16	16	15	14	14	13	13
45 36 46°45'	40 43 47°51'	10	18	18	17	10	16	16	15	15	14	14
40 45 47°51'	47 51 48°58'	19	10	18	18	17	17	16	15	15	14	14
47 51 48°58'	40 00 50°06'	20	19	10	18	17	17	10	16	15	15	14
40 50 50°06'	50 00 51°13'	20	20	19	10	18	18	17	10	16	15	15
50'00 51°13'	52°22'	20	20	20	19	19	18	17	17	10	16	16
52°22'	53°31'	21	20	20	20	19	19	18	18	17	10	16
52 22 53°31'	53 51 54°41'	21	21	20	20	20	19	10	18	18	17	10
54°41'	55°52'	22	21	21	20	20	20	19	18	18	17	17
55°52'	57°04'	22	22	21	21	20	20	20	19	19	18	18
57°04'	57°04 58°17'	23	22	22	21	21	20	20	20	19	19	18
57 04 58°17'	59°32'	23	23	22	22	21	21	20	20	20	19	19
59°32'	60°49'	24	23	23	22	22	21	21	20	20	20	19
60°49'	62°90'	25	24	23	23	23	22	21	21	20	20	20
62°90'	63°30'	25	24	24	23	23	23	22	22	21	20	20
63°30'	64°55'	25	25	24	24	23	23	22	22	22	21	20
64°55'	66°24'	26	26	25	25	24	24	23	23	22	22	21
66°24'	67°57'	20	26	26	25	25	24	23	23	23	22	22
67°57'	69°35'	27	20	26	26	25	25	24	23	23	23	22
69°35'	71°21'	28	27	20	26	26	25	24	24	23	23	23
71°21'	73°16'	28	28	27	20	26	25	25	24	24	23	23
73°16'	75°24'	20	28	28	27	20	26	25	25	24	24	23
75°24'	73 24 77°52'	29	20	28	28	27	20	26	25	25	24	24
73 24 77°52'	80°56'	30	29	20	28	27	27	20	26	25	25	24
80°56'	85°45'	30	30	29	28	28	28	27	20	26	25	25
85°45'	90°00'	30	30	30	29	20	28	27	27	20	26	25
00 40	90 00	J	30	30	29	29	20	20	2 1	21	20	20

9.4 Options

DESCRIPTION PART NUMBER Rechargeable Battery Kit, EX HiCap, R71 30041295 Accessory Tower Kit, R71 30095408 Accessory RS232, Kit, R31, RC31, V71, R71 30037448 Accessory 2nd Platform Kit, R71 30097590 Accessory Discrete I/O, R71 30097591 Accessory Ethernet Kit, R31, RC31, V71, R71 30037447 Alibi Memory Kit, T71, R71 80500503 Accessory Extension Cable 9 Meters, R71 30101495 Accessory In-Use Cover, R71 30135320 Accessory RS232 cable for reference balance 30057595 Auxiliary Display, AD7-RS 30472064 Cable, RS232, IBM 9P 80500525

TABLE 9-4. OPTIONS

9.5 Button Icons List

TABLE 9-5. BUTTON ICONS

	WEIGHING API	PLICATION	
ICON	FUNCTION	ICON	FUNCTION
*	Setup Weighing mode configurations		Edit selected record (used in Library)
Σ	Manual Accumulation		Recall selected record (used in Library)
	Quit (Used in Library)	Ш ^х	Delete selected record (used in Library)
e	Add a record (used in Library)		
	COUNTING AP	PLICATION	
**	Setup Counting mode configurations	•	Add a record (Used in Library)
PCS	Set APW (Average Piece Weight) by number of samples	₩ [×]	Delete selected record (used in Library)
APW	Enter APW (Average Piece Weight) value directly		Recall selected record (used in Library)
Σ	Manual Accumulation		Edit selected record (used in Library)
	Quit (Used in Library)		Set APW by pre-set reference size
	CHECK APPL		
**	Setup Check mode configurations		Quit (Used in Library)
┝∎┥	Change Check limits	+	Add a record (Used in Library)
PCS	Set APW (Average Piece Weight) by number of samples	Ш ^л	Delete selected record (used in Library)
APW	Enter APW (Average Piece Weight) value directly	2	Recall selected record (used in Library)
Σ	Manual Accumulation		Edit selected record (used in Library)
C	Switch the Check Limit's input method		

[TABLE 9-5. BUTTON ICONS (Continued)					
	DENSITY AP					
ICON	FUNCTION	ICON	FUNCTION			
*	Setup Density mode configurations	g/cc	Enter liquid density			
\checkmark	Accept current weight		Start			
	Set water temperature	×	Cancel			
	FILLING APP	PLICATION				
ICON	FUNCTION	ICON	FUNCTION			
\$ <mark>\$</mark> \$	Setup Filling mode configurations	S	Switch the Setpoints' input method			
©	Set input value or current weight on the pan as target		Quit (Used in Library)			
Rsp	Set Target, Setpoint1 and Setpoint2 value	Ð	Add a record (Used in Library)			
	Stop	E E E E E E E E E E E E E E E E E E E	Delete selected record (used in Library)			
	Start		Recall selected record (used in Library)			
Σ	Manual Accumulation		Edit selected record (used in Library)			
	DYNAMIC AP	PLICATION				
ICON	FUNCTION	ICON	FUNCTION			
**	Setup Dynamic mode configurations		Start			
X	Set Averaging Time	Cancel				
Σ	Manual Accumulation	Reset				

	TABLE 9-5. BUTTON		
	DIFFERENTIAL	APPLICATION	
ICON	FUNCTION	ICON	FUNCTION
**	Setup Differential mode configurations	\checkmark	Accept current weight
E ¢	Edit Items	U	Reset
	PERCENT AP	PLICATION	
ICON	FUNCTION	ICON	FUNCTION
**	Setup Percent mode configurations	Σ	Manual Accumulation
	Set reference weight		
	FORMULATION	APPLICATION	
ICON	FUNCTION	ICON	FUNCTION
*	Setup Formulation mode configurations	ê	Print formulation result
Q	Set factor		View selected record (Used in Library)
	Start	Name	Edit record Name (Used in Library)
	Recall selected record (used in Library)	<u>س</u> ر	Delete selected record (Used in Library)
Ŭ	Reset	<	Go back to previous screen
\rightarrow	Next component	>	Go to next screen
	Last Component	D	Add a record (Used in Library)
	Quit (Used in Library)		Edit selected record (used in Library)
H	Save formulation result as a new recept		

RANGER[®] 7000 SCALES

EN-79

ICON	FUNCTION	ICON	FUNCTION
	Guest	+⊜+	Print Range
\$ _p	Login	O	Locate Alibi record

	SIEVE APPLICATION					
ICON	FUNCTION		ICON	FUNCTION		
30	Setup Sieve mode configurations		<u>ل</u> م	View selected record (Used in Library)		
	Manually input start weight		Name	Edit record Name (Used in Library)		
	Start			Delete selected record (Used in Library)		
4	Print sieve analysis result		<	Go back to previous screen (Used in Library)		
\checkmark	Accept current weight		>	Go to next screen (Used in Library)		
×	Cancel		£ ₽	Add a record (Used in Library)		
	Recall selected record (used in Library)			Edit selected record (used in Library)		
	Quit (Used in Library)					

10. COMPLIANCE

Compliance to the following standards is indicated by the corresponding mark on the product.

Mark	Standard
CE	This product complies with the applicable harmonized standards of EU Directives 2011/65/EU (RoHS), 2014/30/EU (EMC), 2014/35/EU (LVD) and 2014/31/EU (NAWI). The EU Declaration of Conformity is available online at www.ohaus.com/ce.
	EN 61326-1
CULUS LISTED E251836 A	UL Std. No. 60950-1 CAN/CSA-C22.2 No. 61010-1

Important notice for verified weighing instruments in the EU

When the instrument is used in trade or a legally controlled application it must be set up, verified and sealed in accordance with local weights and measures regulations. It is the responsibility of the purchaser to ensure that all pertinent legal requirements are met.

Weighing Instruments verified at the place of manufacture bear the following supplementary metrology marking on the descriptive plate.

C € MXX 1259

Weighing Instruments to be verified in two stages have no supplementary metrology marking on the descriptive plate. The second stage of conformity assessment must be carried out by the applicable weights and measures authorities.

If national regulations limit the validity period of the verification, the user of the weighing instrument must strictly observe the re-verification period and inform the weights and measures authorities

As verification requirements vary by jurisdiction, the purchaser should contact their local weights and measures office if they are not familiar with the requirements.

FCC Note

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

Industry Canada Note

This Class A digital apparatus complies with Canadian ICES-001.

ISO 9001 Registration

The management system governing the production of this product is ISO 9001 certified.

Disposal



In conformance with the European Directive 2002/96/EC on Waste Electrical and Electronic Equipment (WEEE) this device may not be disposed of in domestic waste. This also applies to countries outside the EU, per their specific requirements.

The Batteries Directive 2006/66/EC introduces new requirements from September 2008 on removability of batteries from waste equipment in EU Member States. To comply with this Directive, this device has been designed for safe removal of the batteries at end-of-life by a waste treatment facility.

Please dispose of this product in accordance with local regulations at the collecting point specified for electrical and electronic equipment.

If you have any questions, please contact the responsible authority or the distributor from which you purchased this device.

Should this device be passed on to other parties (for private or professional use), the content of this regulation must also be related.

Disposal instructions in Europe are available online at www.ohaus.com/weee.

Thank you for your contribution to environmental protection.

LIMITED WARRANTY

Ohaus products are warranted against defects in materials and workmanship from the date of delivery through the duration of the warranty period. During the warranty period Ohaus will repair, or, at its option, replace any component(s) that proves to be defective at no charge, provided that the product is returned, freight prepaid, to Ohaus.

This warranty does not apply if the product has been damaged by accident or misuse, exposed to radioactive or corrosive materials, has foreign material penetrating to the inside of the product, or as a result of service or modification by other than Ohaus. In lieu of a properly returned warranty registration card, the warranty period shall begin on the date of shipment to the authorized dealer. No other express or implied warranty is given by Ohaus Corporation. Ohaus Corporation shall not be liable for any consequential damages.

As warranty legislation differs from state to state and country to country, please contact Ohaus or your local Ohaus dealer for further details.



Ohaus® and Ranger® are either registered trademarks or trademarks of Ohaus Corporation in the United States and/or other countries. Microsoft®, Windows® and Excel® are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

Ohaus Corporation 7 Campus Drive Suite 310 Parsippany, NJ 07054 USA Tel: +1 (973) 377-9000 Fax: +1 (973) 944-7177

With offices worldwide www.ohaus.com



P/N 30125491F © 2018 Ohaus Corporation, all rights reserved.